## Fire Risk Assessment Meadow Avenue (Aspen)



Charlemont Farm, West Bromwich, B71 3EF.

**Date Completed:** 04/02/2025

Review Period: 12 months

Officer: Anthony Smith Building Safety Manager.

Checked By: Louis Conway Building Safety Manager.

**Current Risk Rating = Trivial** 



## **Subsequent reviews**

Review date	Officer	<u>Comments</u>

### **Contents**

Section 0	Introduction	
Section 1	Significant Findings (executive summary)	
Section 2	People at Significant Risk of Fire	
Section 3	Contact Details	į
Section 4	Description of Premises	į
Section 5	Building Plan	İ
Section 6	External Envelope	İ
Section 7	Means of Escape from Fire	
Section 8	Fire Detection and Alarm Systems	İ
Section 9	Emergency Lighting	
Section 10	Compartmentation	İ
Section 11	Fire Fighting Equipment	İ
Section 12	Fire Signage	İ
Section 13	Employee Training	İ
Section 14	Sources of Ignition	İ
Section 15	Waste Control	İ
Section 16	Control and Supervision of Contractors and Visitors	
Section 17	Arson Prevention	
Section 18	Storage Arrangements	
Section 19	Additional Control Measures. Fire Risk Assessment – Action Plan.	
Appendix 1	Significant Hazards on Site and Information to be provided for the Fire Service Risk Rating of Block	

O

### Introduction

The Regulatory Reform (Fire Safety) Order 2005 (RR(FS)O) places a legal duty on landlords to complete a fire risk assessment (FRA). Specifically, RR(FS)O article 9. — (1) "The responsible person must make a suitable and sufficient assessment of the risks to which relevant persons are exposed for the purpose of identifying the general fire precautions he needs to take to comply with the requirements and prohibitions imposed on him by or under this Order".

This type 1 fire risk assessment has been written to comply fully with the above legislation which is enforced locally by West Midlands Fire Service. If required, complaints can be made to them by telephone on 0121 380 7500 or electronically on <a href="https://www.wmfs.net/our-services/fire-safety/#reportfiresafety">https://www.wmfs.net/our-services/fire-safety/#reportfiresafety</a>. In the first instance however, we would be grateful if you could contact us directly via <a href="https://www.sandwell.gov.uk/info/200195/contact\_the\_council/283/feedback\_and\_complaints">https://www.sandwell.gov.uk/info/200195/contact\_the\_council/283/feedback\_and\_complaints</a> or by phone on 0121 569 6000.

The date of the fire risk assessment is on the front page, followed by any subsequent reviews. A recurring time frame is not set in legislation, but the Council will as a minimum review:

- High Risk Residential Buildings annually
- Other Buildings every 3 years


The council has procedures and policies in place that will trigger a review of the fire risk assessment. This then is recorded on the fire risk assessment. If the review suggests the fire risk assessment is not currently suitable and sufficient, then a new fire risk assessment will be undertaken and become the current fire risk assessment. The previous fire risk assessment will be retained in the building safety case for that building.

The following diagrams illustrate those procedures and persons that support the effective planning, organisation, control, monitoring and review of the preventive and protective measures. This information is provided as required under the RR(FS)O.



The above processes and procedures are overseen by the Fire Safety, Manager who reports to the Head of Building Safety

These managers attend the Building Safety and Compliance Group for scrutiny which is part of the governance structure below.

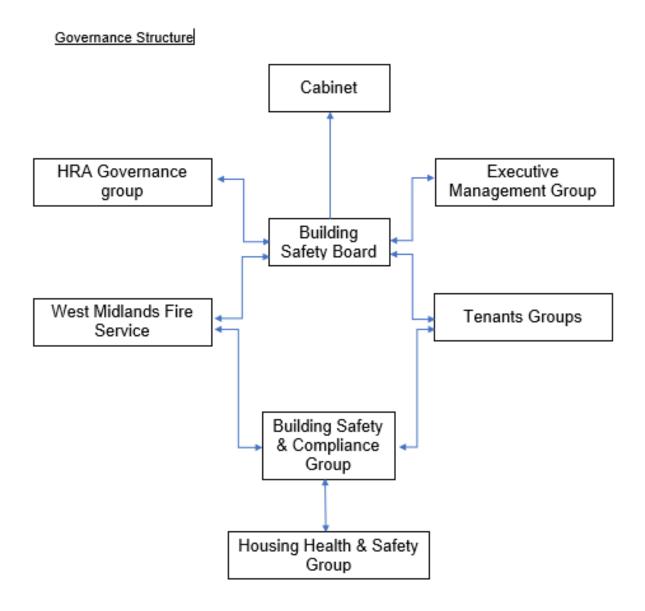

To summarise the fire risk assessment, in this scenario the RR(FS)O requires the prescribed information to be recorded. The prescribed information is the significant findings of the fire risk assessment and those groups or persons especially at risk from fire. This is recorded here in <a href="section 1">section 1</a>. Also required to be recorded under article 11, are the fire safety arrangements for the planning, organisation, control, monitoring and review of the preventative and protective measures. The information shown above is part of this requirement.

1

## Significant findings

The significant findings (executive summary) of the fire risk assessment include those measures that have been or will be undertaken by the responsible person in order to comply with the RR(FS)O 2005. Groups of people especially at risk of fire include such people as remote or lone workers, at risk due to layout of the building, visitors and contractors unfamiliar with the building layout as well as those with physical, sensory or mental health issues.

A third requirement that under the order must be recorded is the fire safety arrangements. This is the effective planning, organisation, control, monitoring and review of the preventive and protective measures. These are shown in the introduction.

### Significant findings

Include a brief summary of protective and preventative measures where relevant along with any issues found;

The escape strategy is 'Stay Put Unless'. This means in the event of a fire in your flat you should evacuate. If there is a fire elsewhere in the building you should stay put unless you are affected by fire, smoke or you have been advised by the emergency services to leave.

Section number	Section Area	Individual Risk Level
Section 6	External Envelope	Trivial
	Brickwork from ground to 1 <sup>ST</sup> floor. Fire classification A1.	
	Wetherby EW1 render system 1 <sup>st</sup> to 8th floor. Fire classification A2	
	Trespa HPL panels to balconies. Fire classification B-s1, d0.	
	Aluminium panels. Fire classification A1.	

Section 7	Means of Escape from Fire	Trivial
	There are two protected stairs that provide sufficient means of escape.	
	Detection for AOV present in lobbies and front stairwell landings.	
	Emergency lighting is provided to communal corridors and stairs.	
	The communal landings and stairs are protected by Notional self-closing FD 30S doors.	
Section 8	Fire Detection and Alarm Systems	Trivial
	Fire detection within sampled flats is installed to LD2 standard.	
	Automatic opening vents are installed to the front stairwell.	
	A deluge system is provided to the bin store.	
Section 9	Emergency Lighting	Trivial
	The premises have a sufficient emergency / escape lighting system.	
Section 10	Compartmentation	Trivial
	The building is designed to provide as a minimum 1-hour vertical fire resistance and 1-hour horizontal fire resistance around flats stairwells and lift shafts.	
	All communal & flat entrance doors are minimum 30-minute fire doors with intumescent strips & cold smoke seals, including those in 1-hour rated walls.	

All service / storage cupboard doors are minimum 44mm 30-minute fire doors.	
Fire Fighting Equipment	Trivial
The dry riser outlets serve all floors from $1^{st}$ to $8^{th}$ .	
Maintenance contracts are in place to service the dry riser twice yearly and the fire extinguisher annually.	
Dry riser inlet located within ground floor dry riser cupboard.	
There is a deluge system in the bin store.	
Fire Signage	Trivial
Escape signage is present.	
LPG cylinder warning signs displayed in lift.	
Wayfinding signage is present.	
Employee Training	Trivial
All staff receive basic fire safety awareness training.	
Sources of Ignition	Trivial
The fixed electric tests should be undertaken every 5 years, last test date: 01/2022.	
Waste Control	Trivial
Regular checks by Caretakers minimise risk of waste accumulation.	
	Fire Fighting Equipment  The dry riser outlets serve all floors from 1st to 8th.  Maintenance contracts are in place to service the dry riser twice yearly and the fire extinguisher annually.  Dry riser inlet located within ground floor dry riser cupboard.  There is a deluge system in the bin store.  Fire Signage  Escape signage is present.  LPG cylinder warning signs displayed in lift.  Wayfinding signage is present.  Employee Training  All staff receive basic fire safety awareness training.  Sources of Ignition  The fixed electric tests should be undertaken every 5 years, last test date: 01/2022.  Waste Control  Regular checks by Caretakers minimise risk

Section 16	Control and Supervision of Contractors and Visitors	Trivial
	Contractors are controlled centrally, and hot works permits are required where necessary.	
Section 17	Arson Prevention	Trivial
	A door entry system prevents unauthorised access.	
	Perimeter lighting is in place.	
	CCTV is in operation.	
Section 18	Storage Arrangements	Trivial
	Residents instructed not to bring L.P.G cylinders into block.	

### **Risk Level Indicator**

The following simple risk level estimator is based on commonly used risk level estimator:

Likelihood of fire	Potential consequences of fire		
Likelinood of fire	Slight harm	Moderate harm	Extreme harm
Low	Trivial risk	Tolerable risk	Moderate risk
Medium	Tolerable risk	Moderate risk	Substantial risk
High	Moderate risk	Substantial risk	Intolerable risk

High	Moder	ate risk	Substantial risk	Intolerable ris
Considering the fire prevention measures observed at the time of this risk assessment, it is considered that the hazard from fire (likelihood of fire) at these premises is:				
Low 🗵 Medium		High □		
In this context, a definit	tion of	the above terr	ns is as follows:	
Low			/ likelihood of fire bootential sources of	
Medium		sources) for the fire hazards g	azards (e.g. potenti his type of occupan enerally subject to ontrols (other than ).	icy, with
High		one or more	uate controls applie significant fire haza sult in significant ind of fire.	rds,
Considering the nature of the premises and the occupants, as well as the fire protection and procedural arrangements observed at the time of this fire risk assessment, it is considered that the consequences for life safety in the event of fire would be:				
Slight Harm ⊠ Mod	derate	Harm □ Ex	ktreme Harm □	
In this context, a definit	tion of	the above terr	ns is as follows:	

Slight harm Outbreak of fire unlikely to result in serious

injury or death of any occupant (other than an occupant sleeping in a room in which a

fire occurs).

Moderate harm Outbreak of fire could foreseeably result in

injury including serious injury) of one or more

occupants, but it is unlikely to involve

multiple fatalities.

**Extreme harm** Significant potential for serious injury or

death of one or more occupants.

Accordingly, it is considered that the risk to life from fire at these premises is:

Trivial ⊠	Tolerable □	Moderate □	Substantial	Intolerable
I I I V I CAI		IVIOGCIALE $\square$		

#### Comments

In conclusion, the likelihood of a fire is at a low level of risk. There have been no fire incidents since the previous Fire Risk Assessment.

After considering the use of the premise and the occupants within the block, the consequences for life safety in the event of a fire would be slight harm. This is due to there being sufficient compartmentation to include Nominal FD30s doors to flat entrances, Notional 30-minute fire doors upgraded with intumescent strips / cold smoke seals to lobby & stairwell. Notional 30-minute fire doors to service cupboards also with intumescent strips and cold smoke seals, with one-hour doors to the lift motor room. Suitable smoke detection to LD2 standard within flats, automatic smoke ventilation system to the front stairwell and a Stay Put – Unless policy.

Overall, the level of risk at the time of this FRA is Trivial.

A suitable risk-based control plan should involve effort and urgency that is proportional to risk. The following risk-based control plan is based on one that has been advocated for general health and safety risks:

Risk level	Action and timescale
Trivial	No action is required, and no detailed records need to be kept.
Tolerable	No major additional fire precautions required. However, there might be a need for reasonably practicable improvements that involve minor or limited cost.
Moderate	It is essential that efforts are made to reduce the risk. Risk reduction measures, which should take cost into account, should be implemented within a defined time period. Where moderate risk is associated with consequences that constitute extreme harm, further assessment might be required to establish more precisely the likelihood of harm as a basis for determining the priority for improved control measures.
Substantial	Considerable resources might have to be allocated to reduce the risk. If the premises are unoccupied, it should not be occupied until the risk has been reduced. If the premises are occupied, urgent action should be taken.
Intolerable	Premises (or relevant area) should not be occupied until the risk is reduced.

(Note that, although the purpose of this section is to place the fire risk in context, the above approach to fire risk assessment is subjective and for guidance only. All hazards and deficiencies identified in this report should be addressed by implementing all recommendations contained in the following action plan. The fire risk assessment should be reviewed regularly.)

2

## People at Significant Risk of Fire

Persons at significant risk of fire does not just refer to those people with physical, sensory or mental health issues. It also includes those at risk due to the layout or features of the building such as inner rooms or dead-end conditions. Persons may also be at risk due to remote or lone working.

The RR(FS)O requires that these people are identified in any fire risk assessment.

Sandwell Council takes the health, safety and wellbeing of its colleagues, contractors, residents and leaseholders seriously. It is our policy to exceed, where possible, the minimum health and safety requirements of the law.

Residents are responsible for letting us know whether they might need a Personal Emergency Evacuation Plan (PEEP). The Resident Engagement Officers (Fire Safety) will conduct an assessment visit upon request. Any risk-reduction measures that are found where a PEEP is necessary and completed will be documented and taken quickly. With the consent of the resident, we will make a referral for West Midlands Fire Service to conduct a Safe and Well visit.

When a PEEP is in place, the relevant information will be kept in the secure Premise Information Box (High Rise Buildings only), which is set up to help WMFS in an emergency. The data is classified as level 1, which means it complies with the General Data Protection Regulations.

3

### **Contact Details**

The Chief Executive of Sandwell Metropolitan Borough Council has ultimate responsibility for the site as the responsible person identified by the RR(FS)O 2005.

The Chief Executive has put a structure in place to support the management of the site.

This includes the role of Building Safety Manager who has duties as defined within the Regulatory Reform (Fire Safety) Order 2005.

The contact names to support the management of the site are as follows:

#### **Chief Executive**

Shokat Lal

#### **Executive Director of Place**

Alan Lunt

### **Assistant Director Asset Management & Improvement**

Sarah Agar

### **Fire Safety Manager**

Tony Thompson

### **Team Lead Fire Safety**

**Jason Blewitt** 

### **Building Safety Managers**

Carl Hill

**Louis Conway** 

**Anthony Smith** 

**Adrian Jones** 

### Resident Engagement Officer - Fire Safety

Abdul Monim Khan Hannah Russon Ethan Somaiya

### **Housing Office Manager**

Lisa Ellis

Please note, the above details are correct at the time of the production of the risk assessment and may be subject to change

## **Description of Premises**

Meadow Avenue 1-71 (Aspen House) Charlemont Farm, West Bromwich, B71 3EF

### **Description of the Property**

The high-rise block was constructed in 1962. The block consists of 9 storeys (inclusive of the ground floor).

Each of the floors contains 4 number dwellings.



The block has a main entrance to the front elevation and a further exit located on the rear elevation.

The fire fighters' white box is located above and to the left of the main entrance. The location of service isolation points for gas, electricity and water are detailed on a plan located in the fire fighter's white box. The box will contain a drop latch key.




There is a Secure Premise Information Box (PIB) located in the lobby. It is a Gerda box that utilises a standard WMFS suited key. The PIB contains floor plans, vertical plans, orientation plans, information for WMFS and documents for those with vulnerabilities who may require additional consideration if there is a fire incident. Keys for WMFS will also be held within the PIB.



### **Orientation Plan**

The location of service isolation points for gas, electricity and water are detailed on a plan located in the fire fighter's white box.

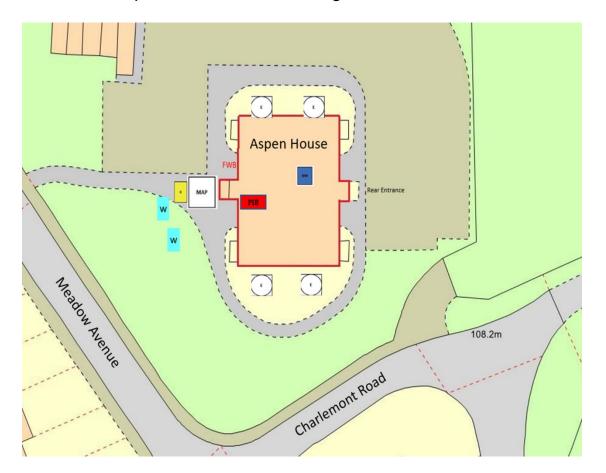

## On arrival Information (for WMFS)

Address: Aspen House, 1-71 Meadow Avenue, B71 3EF	Survey date: 17/03/2023	ON ARRIVAL INFORMATION	
BUILDING LAYOUT			
Size: Width, boadth and height			
Construction	Wates, concrete brick, Brickwork up to 1" floor then Ro	ockwool insulated render system	
Number of floors	9 including ground floor		
Layout		und floor). Each of the floors contains 4 number dwellings,	
	also located on this floor.	rcase to access the 8th floor and the lift motor room that is	
		the block located at the front and rear of the block.	
	3 smoke extraction vents located on front staircase louvre vents, the control panel located within the li Corridors and stairs are protected by FD30s doors.	only on floors 1, 5 and 8 with the rear of the block having obby area nearest the main access point.	
	Corndors and stairs are protected by PUSOS doors.		
Lifts			
Types of entrance doors	timber FD30s	omposite construction. Communal doors within the block are	
Rubbish chutes/ bin rooms	Yes		
Common voids	No		
Access to roof/ service rooms	Access to motor room via full height timber door from 8" floor landing, with a fixed steel ladder to upper level. Then a further fixed vertical steel ladder, through a three-quarter size steel door leading out on the roof.		
Occupants	Арргок. 72 based on an average of 2 occupants per flats (36 flats)		
Evacuation strategy	Stay Put Unless-The escape strategy is "Stay Put Unless". This means in the event of a fire in your flat you should evacuate. If there is a fire elsewhere in the building you should stay put unless you are affected by fire or smoke		
Fire alarm/ evacuation alarm	Early warning is limited to hard wire or battery smoke alarms within each of the resident's flats.		
Caretaker/ concierge	Caretaking/Cleaning service that conducts regular checks of the building		
FIREFIGHTING SYSTEMS			
Water supplies	Fire hydrant is located at the entrance of the building, fire hydrant location/ water isolation points located on the orientation plan, there is a dry riser that serves the building outlet located on the floor plans.		
Fire mains	The dry riser inlet is located within the ground floor dry riser cupboard (twin valve) secured with a type 54 suited mortice lock.		
Firefighting shafts	No firefighting lifts/shafts however there is the ability to take control of the common lift A Firefighter control switch is located within the ground floor lobby		
Smoke control vents	Automatic smoke ventilation is employed on both sets of staircases on floors 1, 5 and 8 with the control panel located within the lobby area nearest the main access point.		
Sprinkler system	A water suppression system is provided to the refuse chute bin store		
DANGEROUS SUBSTAN	CES		
Location, type, and quantity	LOOR 8 TO ALL COMMUNAL LANDING 8 THERMOPLA STIC - SEALED PRESUMED CHRY SOTILE		
	ELECTRICAL FUSE FLASH PADS ROPE - UNSEALED PRESUMED CHRYSOTILE		
SERVICES			
Electricity	Electric meter cupboards located on each floor of the block		
Gas	Gas isolation points located at nearest the main access point of the block and also on the orientation plan		

There is one lift car that serves the floors but only goes to floor 7 as the lift motor room is located on the top floor.



The lift motor room is located on the 8<sup>th</sup> Floor. Access to motor room via full height 60-minute timber fire door. A steel ladder provides access to the upper level then a further fixed vertical steel ladder provides access up to a three-quarter size steel door that leads out on the roof.

The communal, any workplace areas and the external envelope of the building are subject to the Regulatory Reform (Fire Safety) Order 2005 as confirmed by the Fire Safety Act 2021.

The enforcing authority is West Midlands Fire Service.

High/Low Rise	High Rise
Number of Floors	9
Date of Construction	1962
Construction Type	Waites
Last Refurbished	2009
External Cladding	Brickwork to 1 <sup>st</sup> floor. Rockwool insulated render system. Fire classification A2. Aluminium panels. Fire classification A1. HPL panels to balcony. Fire classification B-s1, d0.
Number of Lifts	One
Number of Staircases	Two
Automatic Smoke Ventilation to communal area	Yes (front stairs only floors 8, 5 and 1). Rear stairs have louvre vents.
Fire Alarm System	No
Refuse Chute	Yes
Access to Roof	Access to motor room via full height timber door from 8 <sup>th</sup> floor landing, with a fixed steel ladder to upper level. Then a further fixed vertical steel ladder, through a three-quarter size steel door leading out on the roof.
Equipment on roof (e.g. mobile phone station etc)	No

#### **Persons at Risk**

Residents / Occupants of 36 number of flats.

Visitors,

Sandwell MBC employees,

Contractors,


Service providers (e.g. meter readers, delivery people etc)


Statutory bodies (e.g. W.M.F.S, Police, and Ambulance)


## **Building Plan**


A typical floor layout showing horizontal lines of compartmentation, emergency lighting, fire detection is attached and AOVs etc.


The plans have been shared with WMFS electronically via their portal.

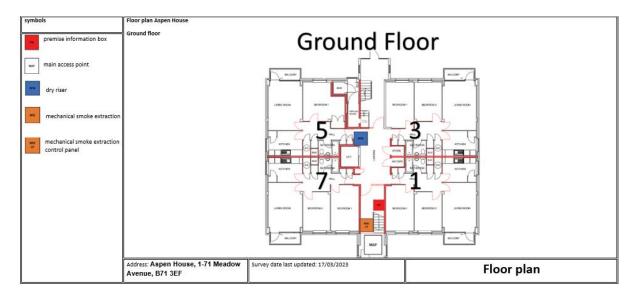


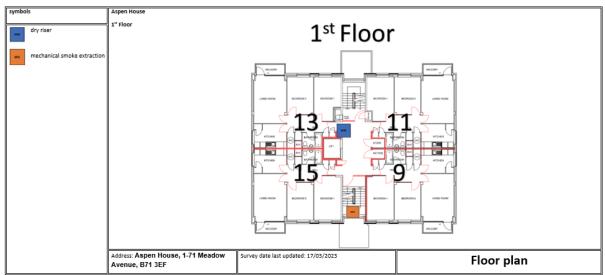


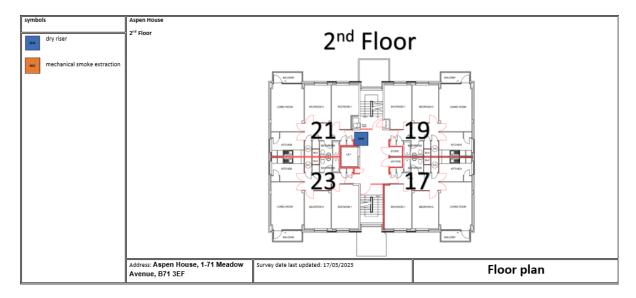


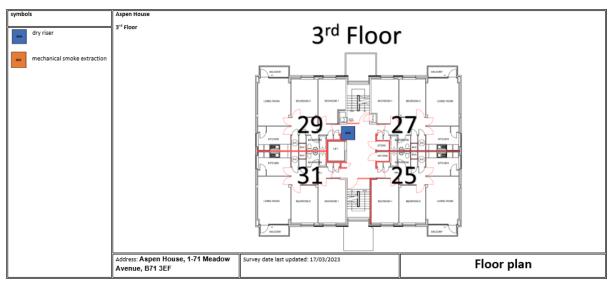


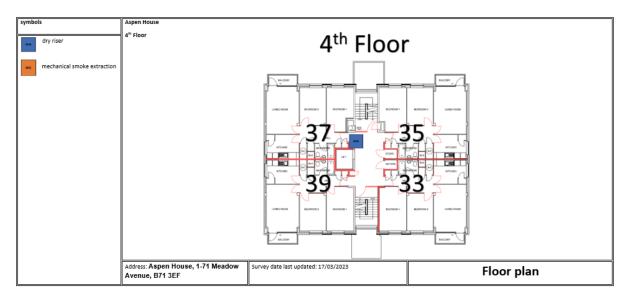

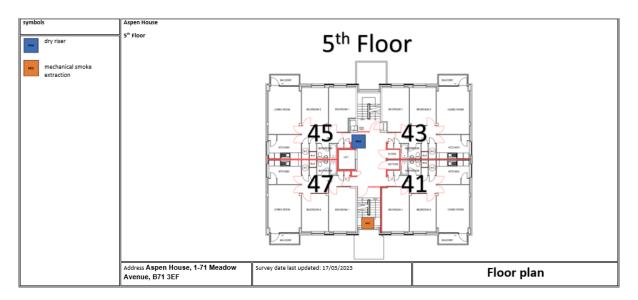

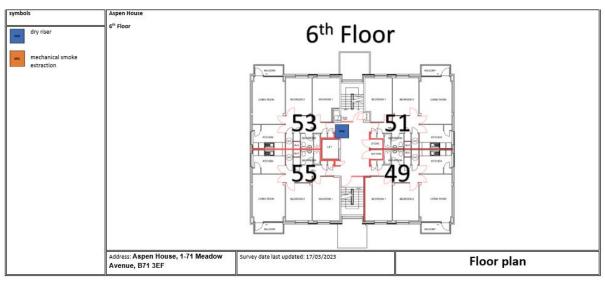

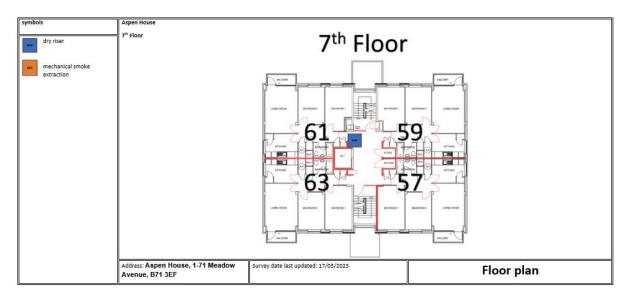

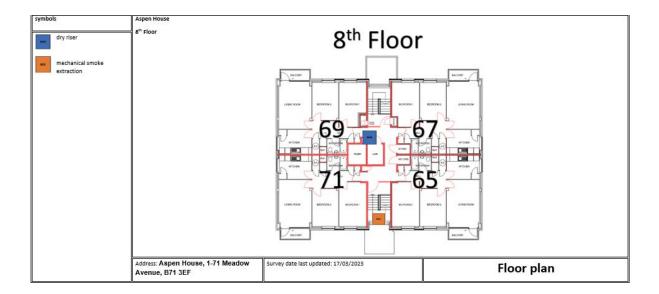

6

### **External envelope**

Following the introduction of the Fire Safety Act 2021, consideration needs to be given to the external envelope of the building for any fire risk. This predominantly means the external wall construction including any insulation filler. It also includes balconies and any other fixtures as well as doors and windows.

Details of the external wall construction have been provided to the fire service via the WMFS portal in line with fire safety regulations 2022

Regarding the external façade, the materials, construction, and their constituent properties have been taken from a database provided by Sandwell Metropolitan Borough Council. A third party approved contractor has been appointed to carry out External Wall Assessments of Sandwell Metropolitan Borough Councils Higher Risk Buildings.

Below is a breakdown of the materials used within the external envelope and, as part of the external wall system of Aspen House. It is deemed that the combination and application of these materials present an acceptable level of fire risk.





## **Means of Escape from Fire**

1) The site has two staircases that provides a means of escape and are 1030mm wide.



2) All corridors are of adequate width (at least 1070mm) and will be maintained clear to that width as a minimum.



- 3) None of the corridors that form part of the means of escape are dead ends.
- 4) The means of escape are protected to prevent the spread of fire and smoke.

5) The communal landing / staircases are protected by use of Notional FD30s fire doors with vision panels. These doors have been upgraded with a combined strip consisting of a cold smoke seal and intumescent strip.



- 6) All communal doors are fitted with automatic closing devices that are checked on a regular basis by Caretaking Teams as part of their checks. Defective closing devices are replaced either by the Caretaking Team(s) or the in-house repairs team(s).
- 7) All communal fire doors are subject to a 12-week check by the Fire Safety Rapid Response Team.
- 8) The final exit doors have door entry systems installed. These systems are designed to fail safe i.e. door unlocked in the event of a power failure. This prevents residents being locked in or out of the building.



9) Automatic smoke ventilation is employed to the front staircase on floors: 1, 5, and 8. This is tested, inspected and maintained by a competent procured contractor in accordance with BS7346. The frequency for the maintenance checks are twice per year (April and October) of each calendar year.







10) The rear staircase has louvre ventilation on all floors. Windows can be opened with use of a key.





11) Communal windows can be opened with the use of a key.



- 12) Communal areas are kept free of flammable items. The communal areas are checked on a regular basis by Caretaking / Cleaning teams 365 days per year and all items of rubbish are immediately removed. There is also an out of hour's service that allows combustible items of furniture / rubbish to be removed
- 13) Emergency lighting is provided to communal landings and stairs. Checks are done on a monthly basis by Sandwell MBC in house electrical team or approved contractor.



- 14) Dry riser cupboard doors are FD30s rated, kept locked / secured with type 54 suited mortice lock(s).
- 15) The dry riser inlet is located within the ground floor dry riser cupboard (twin valve) secured with a type 54 suited mortice lock.



16) Service cupboard doors are FD30S rated, secured with type 138 suited mortice locks. Residents have been provided with a key for access to their electricity meters.





- 17) Surface coatings to the communal areas are Class 0 rated.
- 18) The building has sufficient passive controls that provides effective compartmentation in order to support a Stay Put-Unless Policy. Therefore, residents are advised to remain in their flat unless the fire directly affects them.

19) Individual flat entrance doors are FD 30S rated Permadoor of composite construction.



20) Access is gained to a sample of properties as part of the fire risk assessment to ensure the entrance doors have not been tampered with. Flats accessed were: 5 and 7. Residents confirmed smoke detection provision.

8

### **Fire Detection and Alarm Systems**

- Early warning is limited to hard wire or battery smoke alarms within each of the resident's flats. The equipment is subjected to a cyclical test.
- 2) Based on the sample of properties accessed during the fire risk assessment the smoke alarms within resident's flats are installed to an LD2 Standard (as confirmed by residents).

For information LD1 all rooms except wet rooms LD2 all-risk rooms e.g. Living Room, Kitchens and Hallway. LD3 Hallway only

- 3) There is no effective means for detecting an outbreak of fire to communal areas. The reason for this are:
  - I. Such systems may get vandalised.
  - II. False alarms would occur.
  - III. A Stay Put Unless policy is in place
- 4) A deluge system is provided to the refuse chute bin store. An approved contractor maintains the system. The frequency for the maintenance checks are twice per year (April and October) of each calendar year.

9

## **Emergency Lighting**

- The premises have a sufficient emergency / escape lighting system in accordance with BS 5266 and has test points strategically located.
- 2) The self-contained units are provided to the communal landings, stairs and lift motor room.





3) All installed equipment is checked and tested on a monthly basis by Sandwell MBC in house electrical team or approved contractor, in accordance with current standards.



## Compartmentation

- 1) The building is designed to provide as a minimum 1-hour vertical fire resistance and 1-hour horizontal fire resistance around flats stairwells and lift shafts. All doors are 30-minute fire resistant with cold smoke seals, including those in 1-hour rated walls.
- 2) The premise has sufficient compartmentation to limit the travel and effect of smoke and flame in event of a fire. Whilst the existing fire stopping is fit for purpose, there is a cyclical programme to ensure fire stopping as not been compromised by third parties and where applicable enhance the fire stopping.
- 3) All communal doors are fitted with automatic closing devices that are checked on a regular basis by Caretaking Teams as part of their checks. Defective closing devices are replaced either by the Caretaking Team(s) or the in-house repairs team(s).
- 4) All communal fire doors are subject to a 12-week check by the Fire Safety Rapid Response Team.
- 5) All service cupboards to communal landings are lockable. Keys are held centrally unless containing resident's meters
- 6) The fire stopping / compartmentation is subject to a 12-week check by the Fire Safety Rapid Response Team.
- 7) Any remedial works arising from the fire stopping / compartmentation check(s) will be actioned immediately by the Fire Safety Rapid Response Team.
- 8) The corridors/staircases are protected by the use of Notional fire doors with vision panels. These doors have been upgraded with a combined strip consisting of a cold smoke seal and intumescent strip.



9) Individual flat entrance doors are FD 30S rated Permadoor of composite construction.

### Refer to door sheet below

Meadow Avenue 1-71 (D) Aspen Hou 1-71 Meadow Avenue (Aspen House);Charlemont Fa	arm Estate:West Br	omwich:West Midlands:
Meadow Avenue 1-71 (D) Aspen Hou 1 Meadow Avenue; Charlemont Farm Estate; West	Permadoor	Not glazed
Meadow Avenue 1-71 (D) Aspen Hou 3 Meadow Avenue:Charlemont Farm Estate:West	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 5 Meadow Avenue, Charlemont Farm Estate; West	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 7 Meadow Avenue; Charlemont Farm Estate; West	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 9 Meadow Avenue; Charlemont Farm Estate; West	IG Doors	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 11 Meadow Avenue; Charlemont Farm Estate; Wesl	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 13 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 15 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 17 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 19 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 21 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 23 Meadow Avenue;Charlemont Farm Estate;Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 25 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 27 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 29 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (D) Aspen Hou 31 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 33 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 35 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 37 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 39 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 41 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 43 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (D) Aspen Hou 45 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor Permadoor	Not glazed
Meadow Avenue 1-71 (D) Aspen Hou 47 Meadow Avenue;Charlemont Farm Estate;Wes	Permadoor Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 49 Meadow Avenue;Charlemont Farm Estate;Wes	Permadoor Permadoor	Not glazed
Meadow Avenue 1-71 (0) Aspen Hou 51 Meadow Avenue; Charlemont Farm Estate; Wes Meadow Avenue 1-71 (0) Aspen Hou 53 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed Not glazed
Meadow Avenue 1-71 (D) Aspen Hou 55 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 57 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (D) Aspen Hou 59 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (D) Aspen Hou 61 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (D) Aspen Hou 63 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (D) Aspen Hou 65 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (D) Aspen Hou 67 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (D) Aspen Hou 69 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
Meadow Avenue 1-71 (O) Aspen Hou 71 Meadow Avenue; Charlemont Farm Estate; Wes	Permadoor	Not glazed
(-,		3

10) Access panels to stop taps are fixed to masonry and bedded on Intumescent foam.

11

#### **Fire Fighting Equipment**

 There is a dry riser that serves the building. The dry riser inlet is located within the ground floor dry riser cupboard (twin valve) secured with a type 54 suited mortice lock. The doors have signage depicting dry riser.





- 2) The dry riser is checked regularly as part of the Caretakers duties.
- 3) Maintenance contracts in place to service the valves twice per year (April and October) with a hydraulic test undertaken annually (October) to comply with the requirements of BS9990.
- 4) Portable fire extinguisher (CO2) is provided to the lift motor room. Maintenance contracts in place for maintenance of the extinguisher. The frequency for the maintenance checks is (once) October of each calendar year.
- 5) Bin room is protected by Deluge/sprinkler system and serviced 6-monthly.

#### Fire Signage

1) All fire doors display "Fire Door Keep Shut" where appropriate.



2) Fire Action Notices are displayed throughout the building.



3) Yellow LPG warning signs are displayed within the lift cars.



4) Signage depicting the floor location of each flat is fitted to the ground floor lobby wall.



5) Floor indicator numbers are fitted to the wall on each floor.



6) Floor indicator numbers are fitted to the wall of each floor on the communal staircase(s)



7) Wayfinding signage depicting floor level and flat numbers are located within both staircases and the lift lobby. This meets the requirements within the Fire Safety (England) Regulations 2022.



## **Employee & Resident Training/Provision of Information**


- All Caretaking / Cleaning Employees have undertaken fire safety training. This includes use of bespoke 'Fire Safety in High / Low Rise Flatted Accommodation' Video.
- 2) All employees are encouraged to complete 'In the line of fire' training on an annual basis.
- Caretaking Teams are not currently trained in the effective use of fire extinguishers. The only extinguishers located within the lift motor room. Caretaking Teams are not expected to tackle fires in this area.
- 4) Housing Directorate employees assigned to undertake Fire Safety Inspections have received IFE approved training via West Midlands Fire Service.
- 5) Staff undertaking fire risk assessments are qualified to or working towards Level 4 Diploma in Fire Safety.
- 6) Fire safety information has been provided as part of tenancy pack.
- Building safety and evacuation notices are displayed in common areas and lift cars.
- 8) Information regarding use of fire doors is provided to residents



9) Information regarding the Stay Put unless fire evacuation strategy is provided to residents



10) Information regarding building safety is contained within a Building Safety Notice. This is affixed to the wall on the ground floor lift lobby of high-rise blocks.

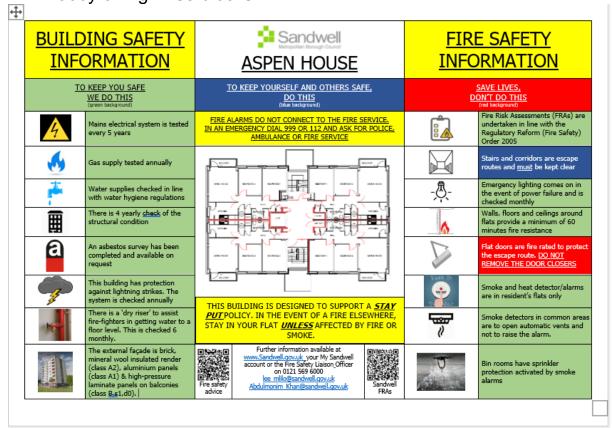

#### **Sources of Ignition**

- Smoking is prohibited within any communal parts of the building in line with Smoke Free England legislation.
- 2) Hot working is not normally carried out. If essential maintenance requires the use of hot work processes, then corporate policies and procedures are to be followed.
- 3) Portable electrical equipment used as part of the Caretaking / Cleaning regime is subject to annual PAT Testing. This information is held by the Estate Services Manager Bryan Low.
- 4) The fixed electrical installation shall be tested every 5 years. It was noted that the last inspection was 01/2022.
- 5) The electrical installation i.e. risers are contained within dedicated service cupboards that are secure and protected by means of a FD30S door.
- 6) There is lightening protection installed to the block. Maintenance contracts are in place for lightning conductor testing in accordance with BS 6651.
- Portable heaters are not allowed in any common parts of the premises.
- 8) Gas appliances and pipework (where installed) are subject to annual testing and certification. This cyclical contract is managed by the in-house Gas Team. The gas supply is external.



#### **Waste Control**

- 1) There is a regular Cleaning Service to the premises.
- 2) Refuse containers emptied regularly.
- 3) Regular checks by Caretakers minimise risk of waste accumulation.
- 4) 'Out of Hours' service in place to remove bulk items.

# section 16

### **Control and Supervision of Contractors and Visitors**

- Responsive Repairs service delivered by Sandwell MBC necessitates the production of an order via the computerised repairs system. Details of any known risks are documented on the repair order.
- 2) Hot works are not permitted unless authorisation is given via the approved officer. The hot works procedure is to be followed.
- 3) Utility companies are not allowed to access any service cupboard or secure area. They must request and collect maintenance keys from the Investments office @ Roway Lane. This allows scrutiny of what is the scope of any works such as installation of tenant's broadband / phone line etc.
- 4) Where contractors are appointed to undertake major refurbishment works, Sandwell MBC Urban Design team will put control measures in place. Such Measures include: -
  - a) Pre-Contract Meetings where contractor is made aware of all working arrangements and safe systems of work to be adopted. Issues covered in this meeting will include:
    - Health and Safety.
    - Site security.
    - Safety of working and impact on children/school business.
    - Fire risk, if any.
      - Site Emergency Plan.
  - b) Monthly Site Meetings in order to monitor, review and share any new information including any new risks.
  - c) Site monitored daily whilst work is in progress by Clerk of Works / Health and Safety Officers.
  - d) Final Contractor review on completion of works undertaken.

#### **Arson Prevention**

- 1) Regular checks are undertaken by Caretakers / Cleaning Team(s) 365 days per year which helps reduce the risk of arson.
- 2) Restricted access to the premises by means of a door entry system.
- 3) There is CCTV system in place that covers the external perimeter and ground floor.
- 4) There is no current evidence of arson.
- 5) The perimeter of the premises is well illuminated.
- 6) There have been no reported fire incidents since the last FRA.

#### **Storage Arrangements**

1) Residents instructed not to bring L.P.G cylinders into block.



- 2) The tenancy conditions, Section 7 Condition 5.6 stipulates "If you live in a flat or maisonette, you, people living with you and any visitors to your property must not keep or use paraffin oil, petrol, bottled gas appliances or any other explosive, FLAMMABLE or dangerous material in the property. This restriction also applies to any storage facility situated in or attached to the block, which has been provided for your use."
- 3) No Flammable liquids stored on site by Caretakers / cleaners.
- 4) All store cupboards are kept locked.
- 5) There are no flammable liquids or gas cylinders stored on site.

### **Additional Control Measures. Fire Risk Assessment - Action Plan**

#### Significant Findings

_			
Л	<b>^</b> +.	· D	lan
_	( :		1411

	sidered tha	at there are no required actions followi risk level is Trivial.	ng this fire risk
Trivial		Tolerable □	

P1 Arrange and complete as urgent – Within 10 days

Definition of priorities (where applicable):

P2 Arrange and complete within 1-3 Months of assessment date

P3 Arrange and complete within 3-6 Months of assessment date

P4 Arrange and complete exceeding 6 months under programmed work



## Fire Risk Assessment Action Plan



Name of	Premises	or
Location.		

Aspen House

Date of Action Plan:

05/02/2025

**Review Date:** 

<Insert date>

Question/ Ref No	Required Action	Supporting photograph	Priority	Timescale and Person Responsible	Date Completed			
No Actions								

#### **Signed**

A. SATH	Building Safety Manager	Date: 05/02/2025
Lange	Quality Assurance Check: Building Safety Manager	Date: 06/02/2025

#### **Appendix 1**


### Significant Hazards on Site and Information to be Provided for the Fire Service

Name of property: Aspen House

**Updated: 24/05/22** 

Premise Tony Thompson: Tel. No.: 0121 569 2975

Hazard	Information/Comments
Asbestos	An asbestos survey has been undertaken of the communal areas. Survey held by Sandwell Housing (Derek Still Tel:- 0121 569 5077).  Include survey

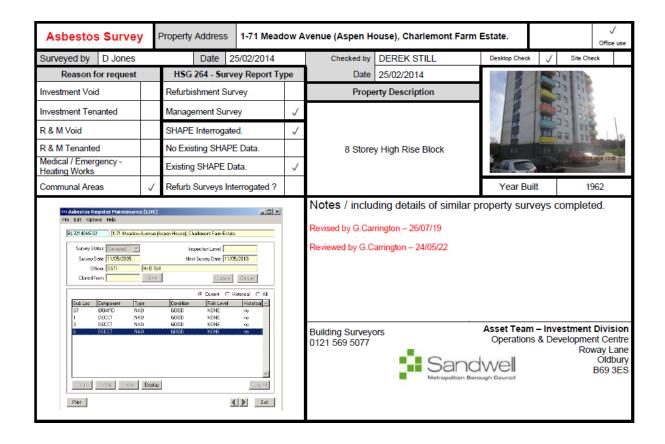

#### Fire Risk Assessment

Sample Locations		Prope Addre		1-71 Mea	dow Avenue (	Aspen House	), Charlemont	Farm E	ACTION TAKEN ON CONTRACT  T STOP WORK & SEEK ADVICE  O NO			
LOCATION		MAT	ERIAL	QTY	SURFACE		RESULT	HSE NOTIF Y	Labelled ?			
IF DURING THE COURSE OF WOR	K SUSF	ECTED A	CM'S ARE	E IDENTIFIE	ED THAT ARE N	OT CONTAINED	WITHIN THIS REF	ORT ST	OP W	ORK & SEEK ADVICE		
F LOORS TO ALL COMMUNAL LANDINGS	3	THERM	OPLASTIC	-	SEALED	PRESUMED	CHRYSOTILE	NO	NO			
ALL COMMUNAL LANDING WALLS		TEXTURE	D COATING	3 -	SEALED	DJ309/001	NO ASBESTOS DETECTED	-	-	-		
ELECTRICAL FUSE FLASH PADS		R	OPE	-	UNSEALED	PRESUMED	CHRYSOTILE	YES	-			
ITEMS SHOWN BELOW HAVE BEEN ASSESSED ON SITE BY THE ASBESTOS SURV						OS SURVEYOR	& ARE CONFIRM	ED NOT	то ве	ACM's.		
LOCATION DESCRIPTION MA		TERIAL	LOC	CATION DE	SCRIPTION	MATERIAL	LOCATIO	N DESC	DESCRIPTION MATERIAL			
		AL FIBRE DARD										
MAIN EXTERNAL ROOF MINE		RAL FELT										
8 <sup>™</sup> FLOOR CUPBOARD ADJ. FLAT 71 CEILING SU		PALUX										
8 <sup>™</sup> FLOOR DRY RISER CUPBOARD CEILING SU		PALUX										
ALL FLATS TO BLOCK ADJ. ENTRANCE DOOR ACCESS PANELS		PALUX										