



FIRNTEC
BUILDING COMPLIANCE

Unit 4a, Darklake View,
Estover
Plymouth
PL6 7TL

Document Version 2
Survey Date 11/06/2025
Suggested Review Date 11/06/2030

EXTERNAL WALL SURVEY

ASTBURY COURT

Kingsway
Brandhall
B68 0QG



Table of Contents

Cover Page	1
Table of Contents	2
Summary	3
Abbreviation/ Term Definition	4
Terms of Reference	5
Asset Information	7
Aerial Perspective: Astbury Court, Kingsway, Brandhill, B68 0QG	11
Elevations	12
Inspections	13
Inspection: NSWVUT	16
Inspection: 4YYTY3	19
Inspection: YR28CF	21
Inspection: A7TMAS	24
Inspection: 3MFYIX	26
Inspection: T25BTE	29
Inspection: EIF3LA	31
Inspection: GLH33H	33
Inspection: C6H63D	35
Inspection: FJINUT	37
Inspection: 9PIF5W	39
Inspection: 4ZXEVK	41
Inspection: B8QK8L	43
External Windows	45
External Window: Top, Mid, Side Hung Casements (6MJ9Q4)	46
External Doors	47
External Door: Single Leaf Entrance Doors (KBR2LB)	48
General Observations	49
Plans & Elevations	51
Photos	54

Summary

External Wall Survey

Assessment and Certificate Reference

RB-HQF7BB

Assessed On, By

11/06/2025, Gary Noel (AIFSM)

Approved / Validated On, By

02/09/2025, James Major (Facade Manager)

Recommended Review Date

11/06/2030

Produced For the Responsible Person

Sandwell Metropolitan Council

Specification Conforms To

Our own internal quality system.

Assessment Scope

Assessment applies only to the building specified.

Assessed Property

Property Name

Astbury Court

Property Reference

RB-QUK8AY

Address

Kingsway

Brandhall

B68 0QG

Assessing Organisation

Firntec Ltd

4a Darklake View, Estover, Plymouth, Devon, PL6 7TL

0345 646 1566 — www.firntec.com

Abbreviation/ Term Definition

- **ACM** Aluminium Composite Material
- **ADB** Approved Document B
- **AOV** Automatic Opening Vent
- **BSA** Building Safety Act
- **Cavity Barrier** Product used to close or separate a concealed space to restrict fire and smoke
- **Close State Cavity Barrier** Cavity Barrier designed to be fitted under compression/friction between inner and outer surfaces of a cavity to seal it
- **Open State Cavity Barrier** Cavity Barrier that is open to allow ventilation/drainage of cavity in open state but closes when a developing fire occurs (e.g., intumescent strip)
- **Combustible** Not classified as A1 OR A2 in accordance with BS EN 13501-1: 2018, and not meeting definitions of non-combustible or limited combustibility
- **Compartmentation** Subdivision of building by fire resisting walls and/or floors for limiting fire spread
- **EPS** Expanded Polystyrene
- **EWS1** External Wall System Fire Valuation Form
- **FB** Fire Barrier - Separating element with fire integrity for a specific time
- **Fire Stop** Barrier seal to close an imperfect fit in design between elements of components to stop the spread of fire
- **FRAEW** Fire Risk Appraisal of External Walls
- **FRA** Fire Risk Assessment
- **FRS** Fire and Rescue Services
- **FSA** Fire Safety Act
- **HPL** High Pressure Laminate
- **HRR** Heat Release Rate
- **MDF** Medium Density Fibre Board (a type of manufactured timber)
- **PIR** Polyisocyanurate Rigid Foam
- **PUR** Polyurethane Foam
- **RP** Responsible Person
- **RRFSO** Regulatory Reform (Fire Safety) Order
- **SFS** Steel Framing System
- **SIB** Secure Information Box # Overview

Terms of Reference

Overview

Firntec have been instructed by the client to undertake an intrusive inspection of the external walls, attachments, windows and doors to the appointed building as addressed on the cover page.

The purpose of the report is to identify the construction, make-up and materials used within each external wall type and attachment on the building as required under the Fire Safety Act 2021.

Scope of Works

The client has requested Firntec to undertake an intrusive inspection of the external walls, attachments, windows and doors.

The purpose of this survey report is to assess the external walls and attachments construction to identify the materials used, installation method, presence of any cavity barriers or fire stopping and the configuration on the building.

For any identified materials within the construction of the sample, a euro-classification rating in accordance with BS EN 13501-1 will be assigned where applicable.

Within the findings of each wall type and attachment, where applicable, detailed comments will be provided on the findings, with reference to quality of workmanship or other identified factors within the construction.

The intent of the report is not to assign any level of risk, conclusion or recommendations, but should it be identified during the intrusive investigation that there is an immediate risk to life safety, interim measures may be recommended.

Limitations

The inspection of any external wall types or attachments are undertaken by the defined terms as described in Approved Document B:

- External Wall: Includes all of the following.
 - Anything located within any space forming part of the wall.
 - Any decoration or other finish applied to any external (but not internal) surface forming part of the wall.
 - Any windows and doors in the wall.
 - Any part of a roof pitched at an angle of more than 70 degrees to the horizontal if that part of the roof adjoins a space within the building to which persons have access, but not access only for the purpose of carrying out repairs or maintenance
- Specific Attachment Includes any of the following.
 - A balcony attached to an external wall.
 - A device for reducing heat gain within a building by deflecting sunlight which is attached to an external wall.
 - A solar panel attached to an external wall.

The findings within the report will not state any areas of compliance with advisory sub-clauses of the relevant Approved Document B, nor does it aim to guarantee compliance with the mandatory clause of B4(1) and our comments cannot be interpreted as such.

We endeavour to undertake intrusive inspections at various elevations and varying heights, however, this may not always be achievable due to mitigating factors out of our control such as access or weather conditions.

The findings of the investigation are limited to each precise inspection location and cannot be used to confirm absolute consistency of the façade in its entirety.

The manufacturer of a product cannot be confirmed with absolute certainty unless the sampled materials carry the product branding inclusive of the product number.

Where product branding is absent or ambiguous, we will where provided, refer to as-built drawings and

specification contained in the O&M manuals, However, this does not guarantee or confirm the products used in construction.

Assumptions

It is understood that the absence of evidence, is not evidence of the absence; therefore, Where a products branding is absent we will use our professional engineering judgment, and any assumptions made with regards to the materials combustibility should be submitted for further testing to verify this.

It has been assumed that documentation regarding the buildings fire safety, fire strategy, construction details and O&M manuals have been provided for our reference within the report.

Outcomes

The findings within this report do not assign any level of risk, conclusion or recommendations, nor does it confirm any compliance with applicable building regulations at the time of construction.

The findings of this report may form part of the gathered information to form such reports as:

- PAS9980:2022 Fire risk appraisal of external wall construction and cladding of existing blocks of flats – Code of practice or;
- External Wall Compliance at Time of Construction Report.

If during the intrusive survey any ACM is identified to be present, this will be reflected within the report and evidence requested to determine its calorific value, if this evidence is not available a request of sample testing may be recommended separate to this report.

Asset Information

Client Name

Sandwell Metropolitan Council

Client Address

Sandwell house, Freeth street, Oldbury, B69 3DB

Contact Details

0121 569 5254

Fire Alarm System

Early warning is limited to hard-wired or battery smoke alarms within each of the residents' flats. Based on the sample of properties accessed during the fire risk assessment the smoke alarms within residents' flats are installed to a minimum of LD3 Standard. There is no effective means for detecting an outbreak of fire to communal areas.

Emergency Lighting

Installed in communal parts

Emergency Lighting

Emergency lighting appears to conform to the requirements of BS5266-1 design standard. The system appears to provide adequate coverage and be in good working order (indicator lights active on luminaires). Luminaires appear to be correctly sited and appear to provide adequate lighting.

Portable Fire Fighting Equipment

Portable Fire Fighting Equipment installed within staff only / Restricted areas of the building

Portable Fire Fighting Equipment

Portable fire extinguisher is in the lift motor room.

Smoke Control

Natural smoke control, Smoke control installed

Smoke Control

The stairs and/or lobbies are provided with adequate permanent or manually operated ventilation openings for the control of smoke. Manual openable windows within the stairwell and the stairs and lobbies are provided with an automatic smoke ventilation system

Suppression Systems

Partial sprinkler system installed (Detailed in Description)

Suppression System

Sprinkler system installed within bin rooms only

Fire Fighting Facilities

Dry Riser

Fire Fighting Facilities

Dry riser outlets were located on each floor within the firefighting lobby area, ensuring accessible water supply for

firefighting operations. This placement allows for efficient connection of firefighting hoses, providing vital water access to emergency services during fire incidents across all floor levels.

Access for fire-fighting vehicles

Adequate access for firefighting vehicles
NOTE This is where access is possible in line with benchmark guidance on access for firefighting vehicles from Approved Document B, taking into account the size of the building (floor area), height of the building and whether fire mains are present in the building.

Fire Hydrant Location/ Water Supply

Public fire hydrant are available. The fire hydrant is adjacent the front entrance to the building (approx 5m) as detailed in the on arrival information.
Public fire hydrants can be located: <https://dataservices.riscauthority.co.uk/map/index>

Housekeeping

Good standard. Means of escape clear. Refuse stored appropriately

Secure Information Boxes

Secure information box (SIB) installed

Signage

Appropriate signage installed throughout premises

Property Type

Residential, General Needs

Building Era / Age

Known Build Date

Known Build Date

1964, Refurbished in 2007 and 2017

Guidance Applicable At Time Of Construction

Model Byelaws 1953
Building Regulations 2000 and Approved Document B Volume 2 2006

Building Height

Overall Building Height Approximately 25m
Highest Occupied Floor Level 21m
(calculated at 3m per floor as per PAS 9980-2022 section 3.1.22)

Number of Storeys (Ground and above)

8

Number of Flats

48

Flat Types

Single Storey

Structural Wall Material

Concrete / Brick

Structural Floor Material

Reinforced Concrete

Structural Stairs Material

Concrete

Construction (Details)

Traditional concrete frame and brick construction

Exterior Cladding

FRAEW Completed on Exterior Cladding

Exterior Cladding (Details)

Terracotta tiles and aluminium panels

Electronic Entrance System

Yes

Carpark

External/Outdoor Carpark

Employees

None

Residents

Yes

Approx number of Residents

96

Residents (Extended)

Assumed to be two residents per flat (Exact numbers not known)

Visitors

Not Known

People With Reduced Mobility

Not Known

Lone Workers

None

Young Persons Employed in the Premises

None

Escapes & Exits

There are sufficient fire exits from the premises of suitable width and within acceptable travel distances. These will allow all persons in the premises to evacuate safely in the event of fire. Emergency exits open outwards in escape direction.

Number Of Internal Escape Stairs

1

Number Of Final Exits

2

External Means Of Escape

None Present

Types Of Lifts Installed

Passenger + Fireman's Control

Evacuation Chairs Installed

No

Refuge Points Present

No

Stairwells Protected / Lobbied

Yes

Flat Doors Open Onto Stairs

No

Current Evacuation Strategy


Stay Put

Current Stay Put Strategy Description

The current evacuation strategy is Stay Put as denoted by the fire action notices displayed in the common area.

Aerial Perspective: Astbury Court, Kingsway, Brandhill, B68 0QG

Aerial Perspective (picture sourced from Google Earth)

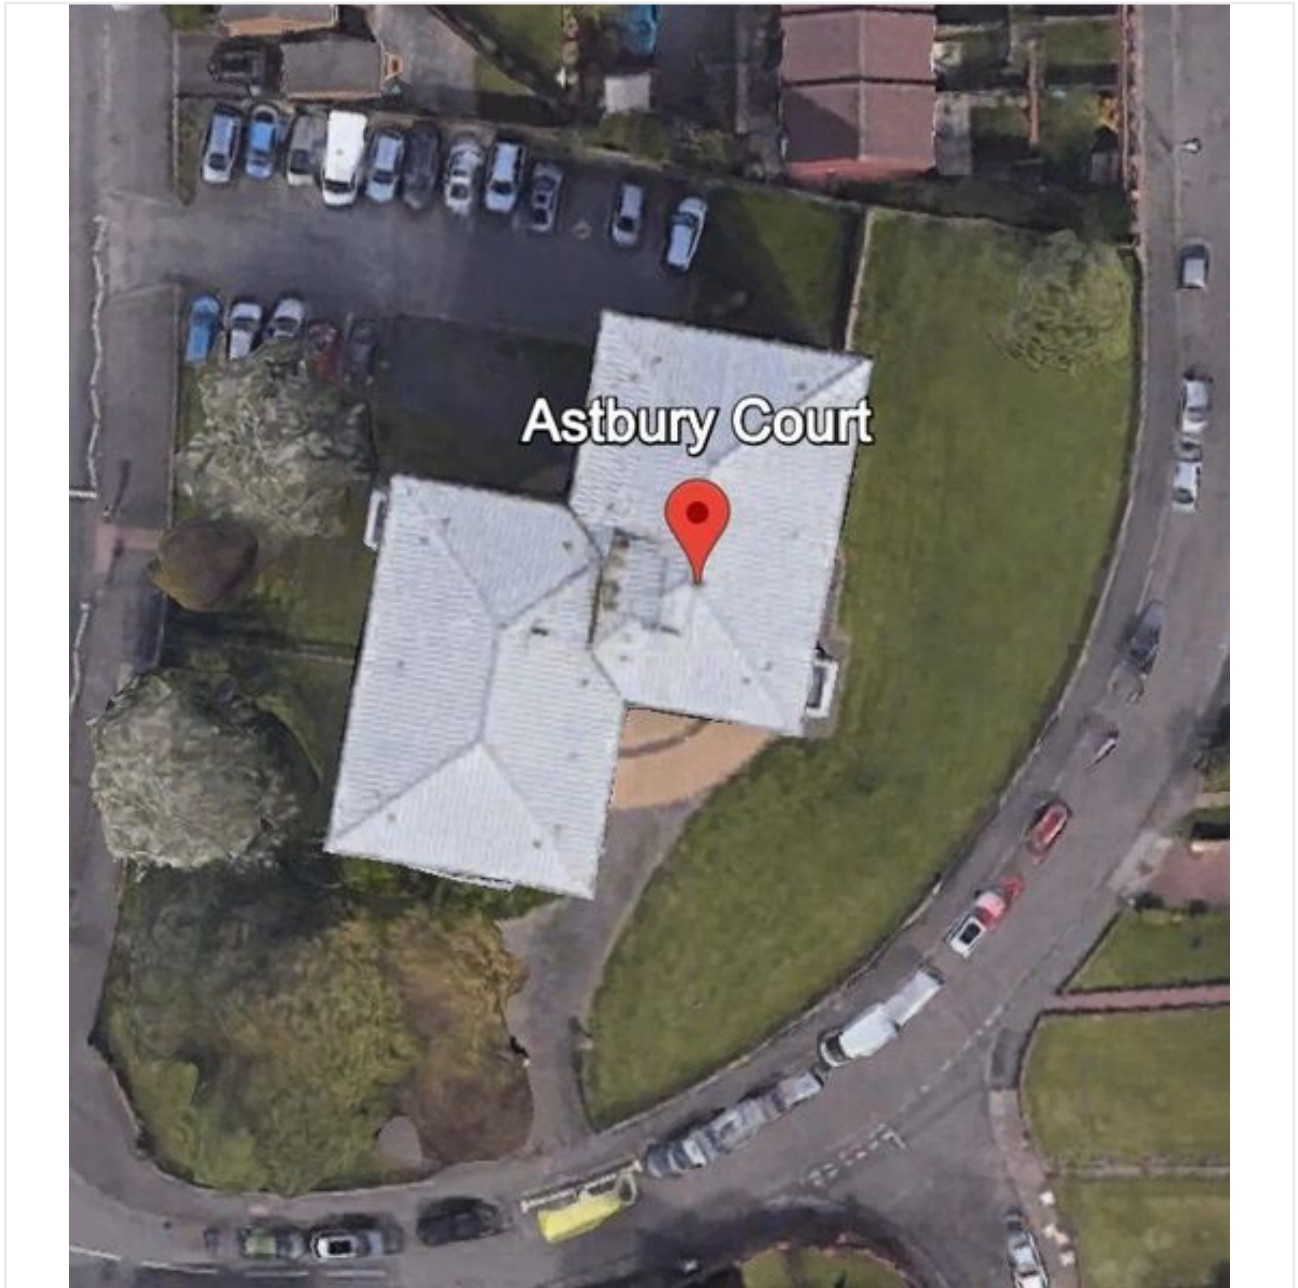

Elevations

Photo	Name	No. of Storeys
	NORTH	9 Storeys
	SOUTH	9 Storeys
	EAST	9 Storeys
	WEST	

Inspections

Elevation Location


Inspection

Elements




Inspection: NSWVUT
Wall Inspection
Compartment Floor Junction

- External Surface Material (Aluminium Panel)
- Framework (Aluminium L/T Rail)
- Cavity
- Insulation (Mineral Wool Insulation)
- Substrate (Original brickwork)

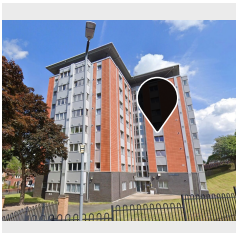


Inspection: 4YYTY3
Wall Inspection
Compartment Floor Junction

- External Surface Material (Aluminium Panel)
- Framework (Aluminium L/T Rail)
- Cavity
- Insulation (Mineral Wool Insulation)
- Substrate (Original brickwork)

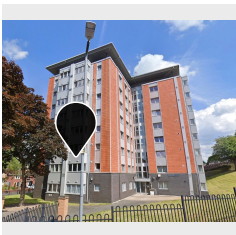


Inspection: YR28CF
Wall Inspection
Compartment Floor Junction

- External Surface Material (Aluminium Panel)
- Framework (Aluminium L/T Rail)
- Cavity
- Insulation (Mineral Wool Insulation)
- Substrate (Original brickwork)

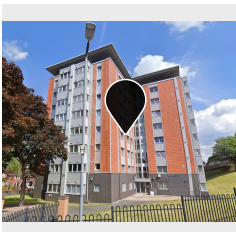




Inspection: A7TMAS
Wall Inspection
Compartment Floor Junction



- External Surface Material (Terracotta Tile)
- Framework (Aluminium L/T Rail)
- Cavity
- Insulation (Mineral Wool Insulation)
- Substrate (Original brickwork)

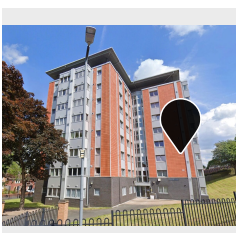

Inspection: 3MFYIX
Wall Inspection
Ventilation Outlet

- External Surface Material (Terracotta Tile)
- Outer leaf
- Framework (Aluminium L/T Rail)
- Cavity
- Insulation (Mineral Wool Insulation)
- Other (Expanding foam)
- Substrate (Original brickwork)

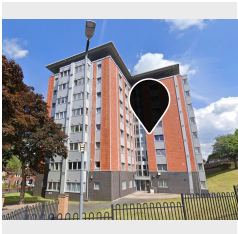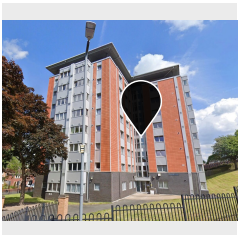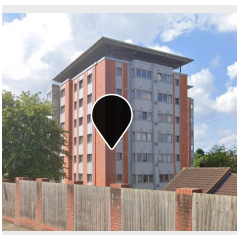Elevation Location	Inspection	Elements
	Inspection: T25BTE Wall Inspection Aperture Opening	• External Surface Material (Brickwork) • Cavity • Substrate (Original brickwork)
	Inspection: EIF3LA Wall Inspection Aperture Opening	• External Surface Material (Brickwork) • Insulation (Mineral Wool Insulation) • Substrate (Original brickwork)
	Inspection: GLH33H Wall Inspection Compartment Floor and Wall Junction Interface	• External Surface Material (Terracotta Tile) • Framework (Aluminium L/T Rail) • Cavity • Insulation (Mineral Wool Insulation) • Substrate (Original brickwork)
	Inspection: C6H63D Wall Inspection Aperture Opening	• External Surface Material (Aluminium Panel) • Framework (Aluminium L/T Rail) • Insulation (PIR Insulation) • Internal Lining
	Inspection: FJINUT Wall Inspection Aperture Opening	• External Surface Material (Aluminium Panel) • Framework (Aluminium L/T Rail) • Cavity • Insulation (Mineral Wool Insulation) • Substrate (Original brickwork)
	Inspection: 9PIF5W Wall Inspection Compartment Wall Junction	• External Surface Material (Terracotta Tile) • Framework (Aluminium L/T Rail) • Cavity • Insulation (Mineral Wool Insulation) • Substrate (Original brickwork)

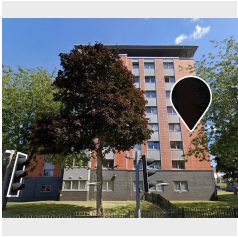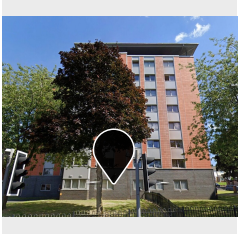Elevation Location	Inspection	Elements
	Inspection: 4ZXEVK Wall Inspection Compartment Floor and Wall Junction Interface	• External Surface Material (Terracotta Tile) • Framework (Aluminium L/T Rail) • Cavity • Insulation (Mineral Wool Insulation) • Substrate (Original brickwork)
	Inspection: B8QK8L Wall Inspection Aperture Opening	• External Surface Material (Brickwork) • Insulation (Mineral Wool Insulation) • Substrate (Original brickwork)

Inspection: NSWVUT

Elevation • Location
Wall Inspection • Compartment Floor Junction



Name/Summary

Infill panel

Build-Up

5 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	3mm	Aluminium Panel	5, 6	A2 - Limited Combustibility
Framework	30mm	Aluminium L/T Rail	7	A2 - Limited Combustibility
Cavity	105mm		8	
Insulation	100mm	Mineral Wool Insulation	9, 10	A1 - Non-Combustible
Substrate		Original brickwork	9	A1 - Non-Combustible

Cavity Barriers


1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Stonewool core, aluminium foil faces and intumescent strip leading edge Material Brand: Rockwool	11

Cavity closed at compartmentation wall

Floor Slab

Backing Wall Sits On The Floor Slab

Build-up Photos

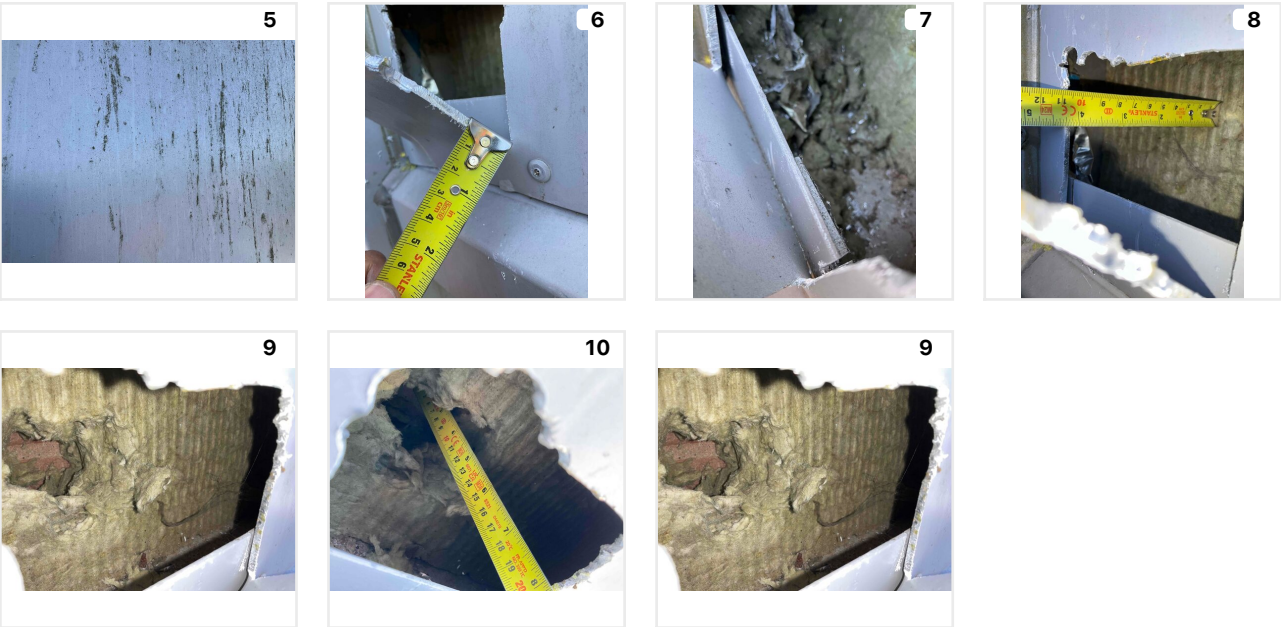

Cavity Barrier Photos



Inspection Photos



Inspection: 4YYTY3

Elevation • Location
Wall Inspection • Compartment Floor Junction



Name/Summary

Infill panel

Build-Up

5 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	3mm	Aluminium Panel	13, 14	A2 - Limited Combustibility
Framework		Aluminium L/T Rail	15	A2 - Limited Combustibility
Cavity	85mm		16	
Insulation	100mm	Mineral Wool Insulation	17, 18	A1 - Non-Combustible
Attached via mechanical fixers				
Substrate		Original brickwork	19	A1 - Non-Combustible



Cavity Barriers

1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Stonewool core, aluminium foil faces and intumescent strip leading edge Material Brand: Rockwool	20


Floor Slab

Backing Wall Sits On The Floor Slab

Build-up Photos

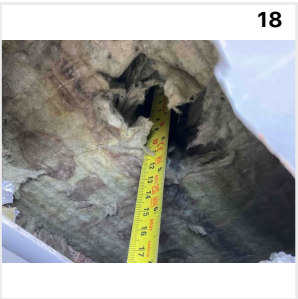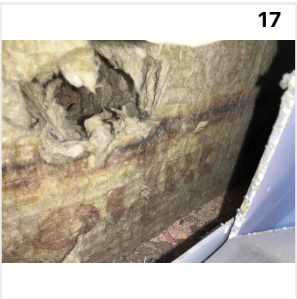

Cavity Barrier Photos

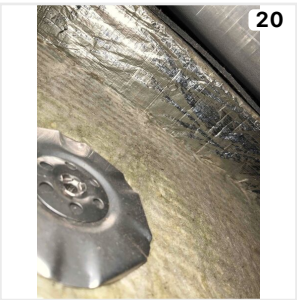

Inspection: YR28CF

Elevation • Location
Wall Inspection • Compartment Floor Junction



Name/Summary

Infill panel

Build-Up

5 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	3mm	Aluminium Panel	21, 22	A2 - Limited Combustibility
Framework	30mm	Aluminium L/T Rail	23	A2 - Limited Combustibility
Cavity	100mm		24	
Insulation	100mm	Mineral Wool Insulation	25, 26	A1 - Non-Combustible
Attached via mechanical fixers				
Substrate		Original brickwork	27	A1 - Non-Combustible

Cavity Barriers


1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Stonewool core, aluminium foil faces and intumescent strip leading edge Material Brand: Rockwool	28

Cavity closed at compartmentation wall

Floor Slab

Backing Wall Sits On The Floor Slab

Build-up Photos

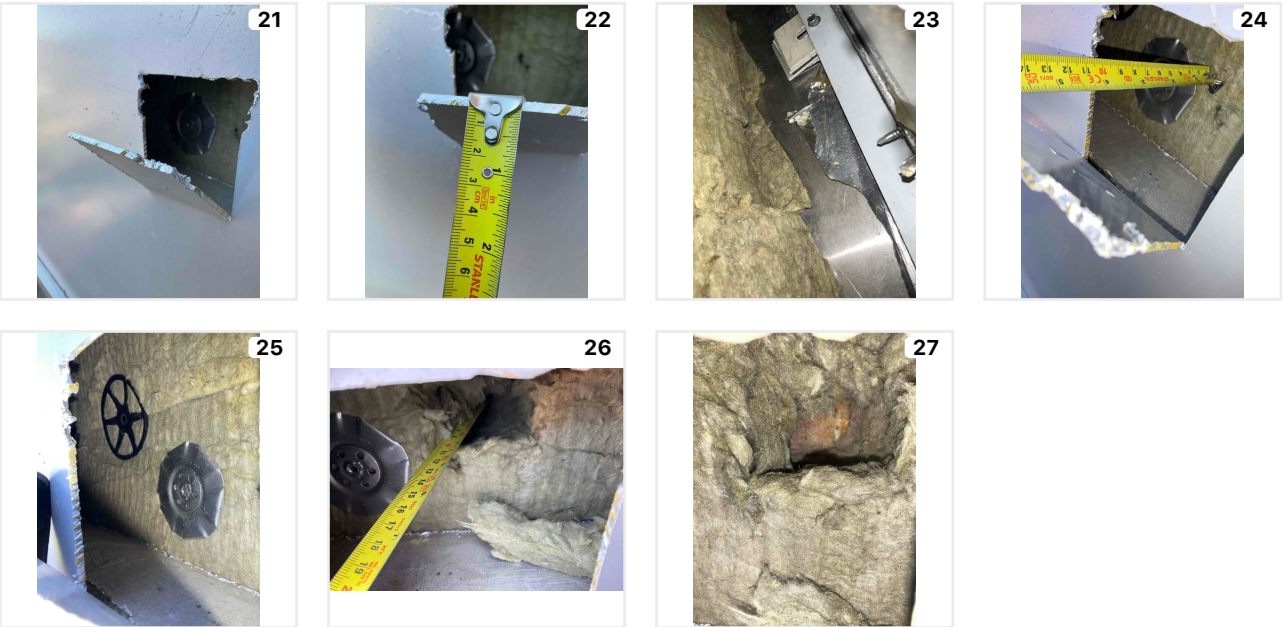

Cavity Barrier Photos



Inspection Photos



Inspection: A7TMAS

Elevation • Location
Wall Inspection • Compartment Floor Junction



Name/Summary

Rainscreen

Build-Up

5 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	15mm	Terracotta Tile	30, 31	A1 - Non-Combustible
Framework	30mm	Aluminium L/T Rail	32	A2 - Limited Combustibility
Cavity			33	
Insulation	100mm	Mineral Wool Insulation	34, 35	A1 - Non-Combustible
Substrate		Original brickwork	36	A1 - Non-Combustible

Cavity Barriers


1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Stonewool core, aluminium foil faces	37

Cavity closed at compartmentation wall

Floor Slab

Backing Wall Sits On The Floor Slab


Build-up Photos

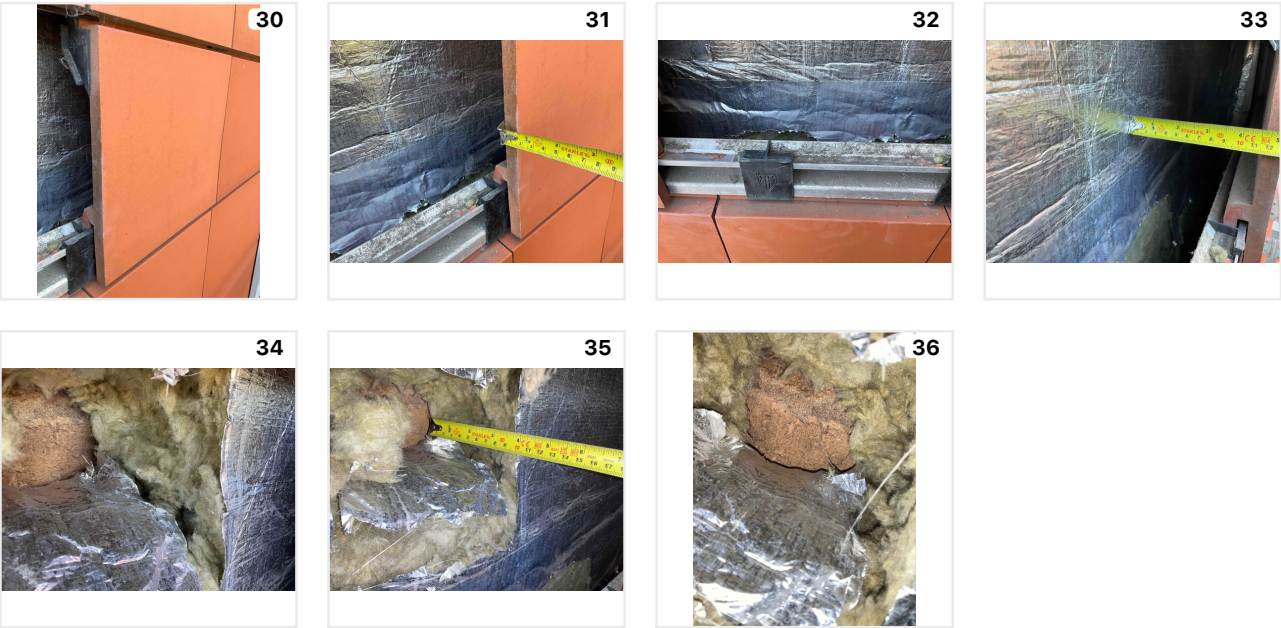

Cavity Barrier Photos



Inspection Photos

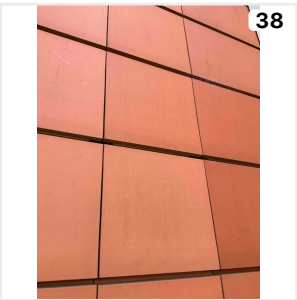

Inspection: 3MFYIX

Elevation • Location
Wall Inspection • Ventilation Outlet



Name/Summary

Rainscreen

Description

Flue penetration not fire stopped

Build-Up

7 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	5mm	Terracotta Tile	39, 40	A1 - Non-Combustible
Outer leaf		Material Brand: Cement board	41, 42	B - Combustible
Framework	30mm	Aluminium L/T Rail	43, 44	A2 - Limited Combustibility
Cavity	80mm		45	
Insulation	100mm	Mineral Wool Insulation	46, 47	A1 - Non-Combustible
Other		Expanding foam	48	F - Highly Combustible
Substrate		Original brickwork	49	A1 - Non-Combustible


Cavity Barriers

1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Stonewool core, aluminium foil faces	50
Cavity closed at compartmentation wall		

Floor Slab

Backing Wall Sits On The Floor Slab


Build-up Photos

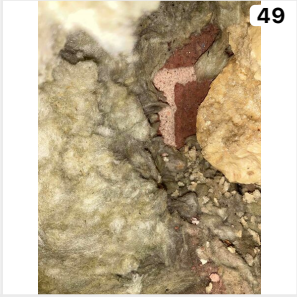

Cavity Barrier Photos



Inspection Photos

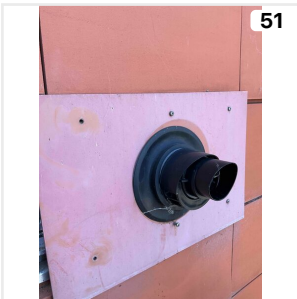

Inspection: T25BTE

Elevation • Location
Wall Inspection • Aperture Opening



Name/Summary

Masonry

Build-Up

3 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	102mm	Brickwork	52, 53	A1 - Non-Combustible
Cavity	210mm		54	
Substrate		Original brickwork	55	A1 - Non-Combustible


Cavity Barriers

No cavity barrier identified at this inspection location


Floor Slab

Backing Wall Sits On The Floor Slab

Build-up Photos

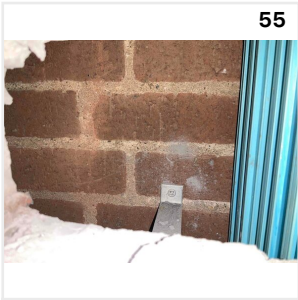

Inspection Photos

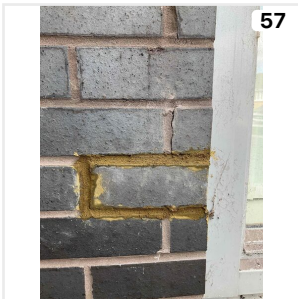

Inspection: EIF3LA

Elevation • Location
Wall Inspection • Aperture Opening



Name/Summary

Masonry

Build-Up

3 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	102mm	Brickwork	58	A1 - Non-Combustible
Insulation	210mm	Mineral Wool Insulation	59, 60	A1 - Non-Combustible
Substrate		Original brickwork	61	A1 - Non-Combustible

Cavity Barriers

1 Cavity Barrier	Material	Photo Ref.
Window Aperture	Solid State Mineral Wool	59

Cavity closed at the window opening

Floor Slab

Backing Wall Sits On The Floor Slab

Build-up Photos



Cavity Barrier Photos



Inspection Photos



Inspection: GLH33H

Elevation • Location
Wall Inspection • Compartment Floor and Wall Junction Interface



Name/Summary

Rainscreen

Build-Up

5 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	15mm	Terracotta Tile	64, 65	A1 - Non-Combustible
Framework	30mm	Aluminium L/T Rail	66	A2 - Limited Combustibility
Cavity	135mm		67	
Insulation	100mm	Mineral Wool Insulation	68, 69	A1 - Non-Combustible
Substrate		Original brickwork	70	A1 - Non-Combustible

Cavity Barriers


1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Stonewool core, aluminium foil faces	71

Cavity closed at compartmentation wall

Floor Slab

Backing Wall Sits On The Floor Slab

Build-up Photos

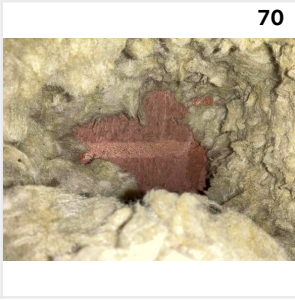

Cavity Barrier Photos



Inspection: C6H63D

Elevation • Location
Wall Inspection • Aperture Opening



Name/Summary

Infill panel stairwell

Build-Up

4 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
------------	-----------------	----------	------------	---------------------

External Surface Material	2mm	Aluminium Panel	72, 73	A2 - Limited Combustibility
---------------------------	-----	-----------------	--------	-----------------------------

Framework		Aluminium L/T Rail	74	A2 - Limited Combustibility
-----------	--	--------------------	----	-----------------------------

Insulation	180mm	PIR Insulation	75	C - Combustible
------------	-------	----------------	----	-----------------

Double insulated board

Internal Lining			76	A2 - Limited Combustibility
-----------------	--	--	----	-----------------------------

Aluminium panels

Cavity Barriers

1 Cavity Barrier	Material	Photo Ref.
------------------	----------	------------



Horizontal Cavity Barrier	Solid State Mineral Wool	77, 78
---------------------------	--------------------------	--------

Cavity sock at floor level

Floor Slab

Reinforced concrete

Build-up Photos

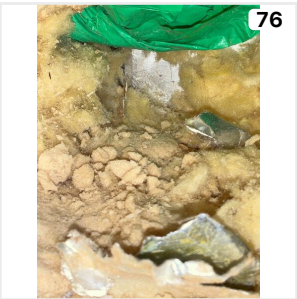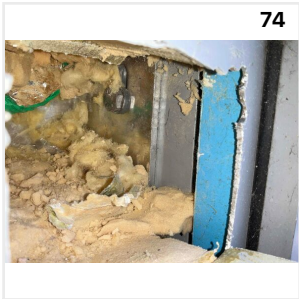

Cavity Barrier Photos



Inspection: FJINUT

Elevation • Location
Wall Inspection • Aperture Opening



Name/Summary

Infill panel

Build-Up

5 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	3mm	Aluminium Panel	79, 80	A2 - Limited Combustibility
Framework		Aluminium L/T Rail	81	A2 - Limited Combustibility
Cavity	115mm		82	
Insulation	100mm	Mineral Wool Insulation	83	A1 - Non-Combustible
Substrate		Original brickwork	83	A1 - Non-Combustible

Cavity Barriers

1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Stonewool core, aluminium foil faces and intumescent strip leading edge Material Brand: Rockwool	84

Cavity closed at compartmentation wall


Floor Slab

Backing Wall Sits On The Floor Slab

Build-up Photos



Cavity Barrier Photos

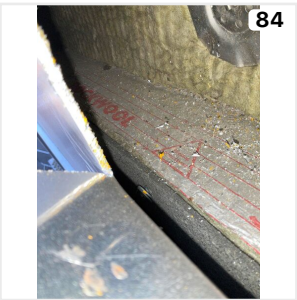

Inspection: 9PIF5W

Elevation • Location
Wall Inspection • Compartment Wall Junction



Name/Summary

Rainscreen

Build-Up

5 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	15mm	Terracotta Tile	85, 86	A1 - Non-Combustible
Framework	30mm	Aluminium L/T Rail	87	A2 - Limited Combustibility
Cavity	115mm		88	
Insulation	100mm	Mineral Wool Insulation	89	A1 - Non-Combustible
Substrate		Original brickwork	90	A1 - Non-Combustible

Cavity Barriers

1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Stonewool core, aluminium foil faces	91

Cavity closed at compartmentation wall


Floor Slab

Backing Wall Sits On The Floor Slab

Build-up Photos



Cavity Barrier Photos

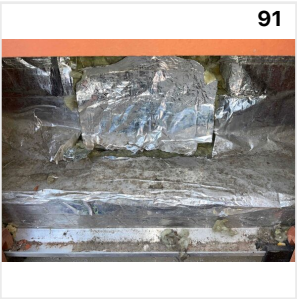

Inspection: 4ZXEVK

Elevation • Location
Wall Inspection • Compartment Floor and Wall Junction Interface



Name/Summary

Rainscreen

Build-Up

5 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	15mm	Terracotta Tile	92, 93	A1 - Non-Combustible
Framework	30mm	Aluminium L/T Rail	94, 95	A2 - Limited Combustibility
Cavity	120mm		96	
Insulation	100mm	Mineral Wool Insulation	97, 98	A1 - Non-Combustible
Substrate		Original brickwork	99	A1 - Non-Combustible

Cavity Barriers

1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Stonewool core, aluminium foil faces	100

Cavity closed at compartmentation wall


Floor Slab

Backing Wall Sits On The Floor Slab

Build-up Photos



Cavity Barrier Photos

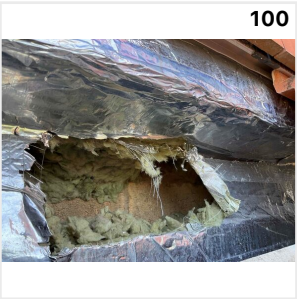

Inspection: B8QK8L

Elevation • Location
Wall Inspection • Aperture Opening



Name/Summary

Masonry

Build-Up

3 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	102mm	Brickwork	101	A1 - Non-Combustible
Insulation	210mm	Mineral Wool Insulation	102, 103	A1 - Non-Combustible
Substrate		Original brickwork	103	A1 - Non-Combustible

Cavity Barriers


1 Cavity Barrier	Material	Photo Ref.
Window Aperture	Solid State Mineral Wool	102

Cavity closed at the window opening

Floor Slab

Backing Wall Sits On The Floor Slab

Build-up Photos

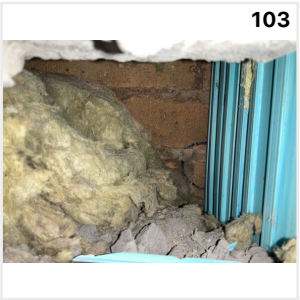

Cavity Barrier Photos



External Windows

Photo

External Window



Top, Mid, Side Hung Casements (6MJ9Q4)

External Window: Top, Mid, Side Hung Casements

External Window Reference
6MJ9Q4

Details

Surface Material

Aluminium

Infill / Panel Material

Toughened Safety Glass

Frame Material

Aluminium

Details

Confirmation via magnet

Photos



External Doors

Photo

External Door



Single Leaf Entrance Doors (KBR2LB)

External Door: Single Leaf Entrance Doors

External Door Reference
KBR2LB

Details

Surface Material

Aluminium

Infill / Panel Material

Toughened Glass

Frame Material

Aluminium














Details


Front/back entrance doors

Photos



General Observations

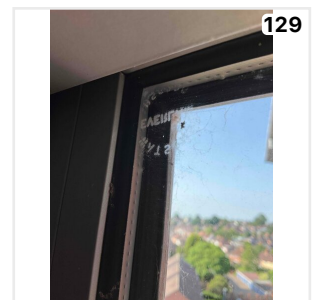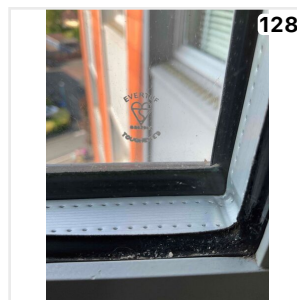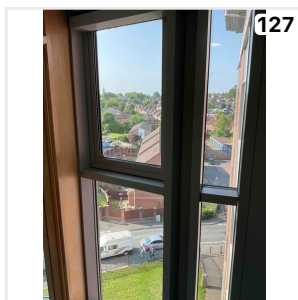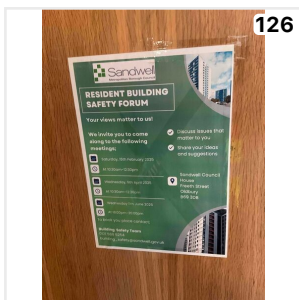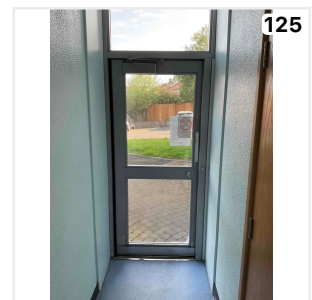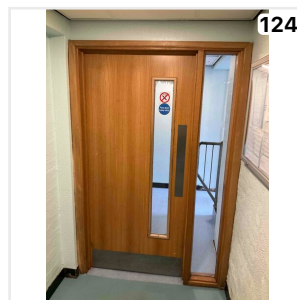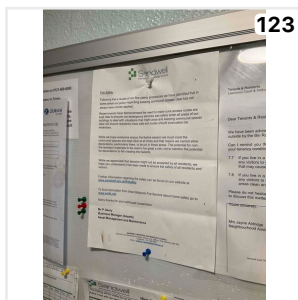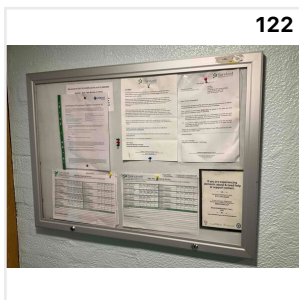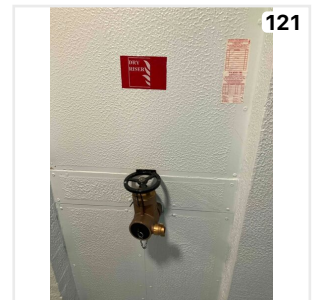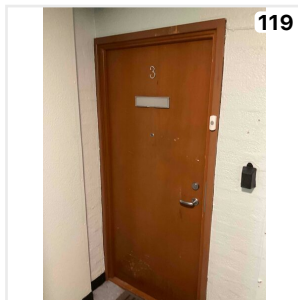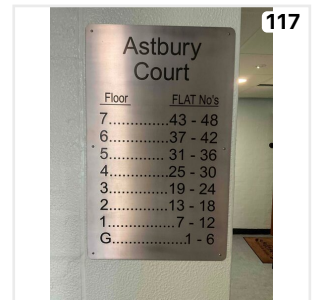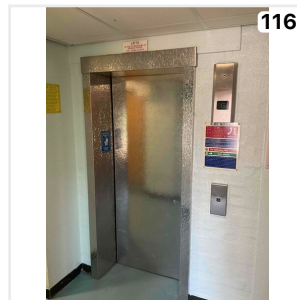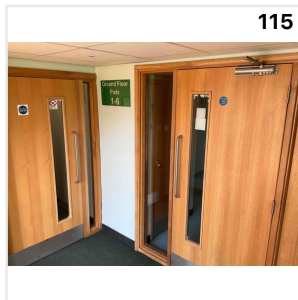


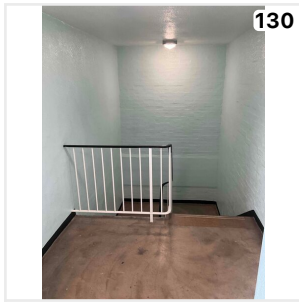


130



131

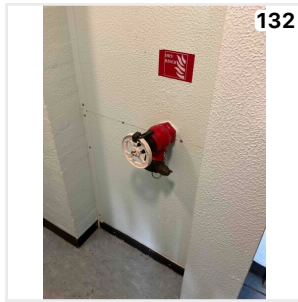


132

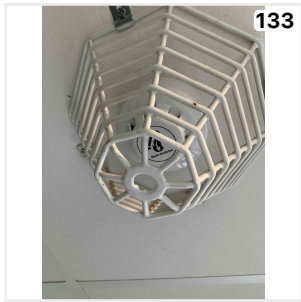

133



134

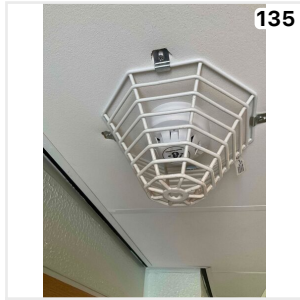

135




136




137




138

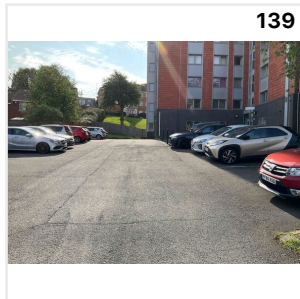


139

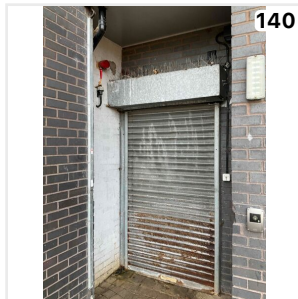


140

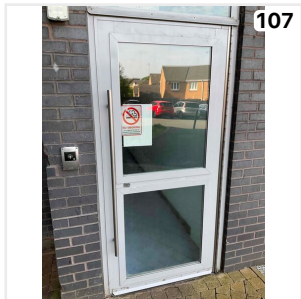

107

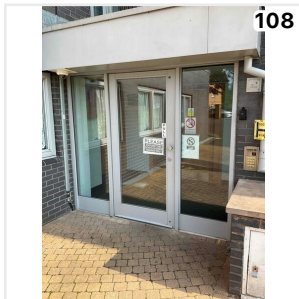

108

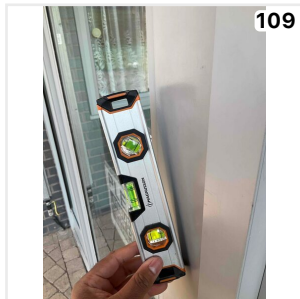

109

Plan: Wall Inspection





Plan: Wall Inspection




Plan: Wall Inspection




Photos

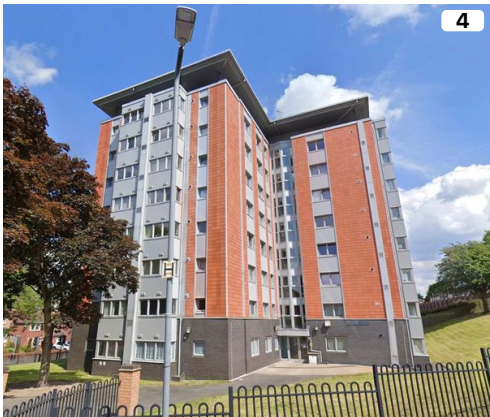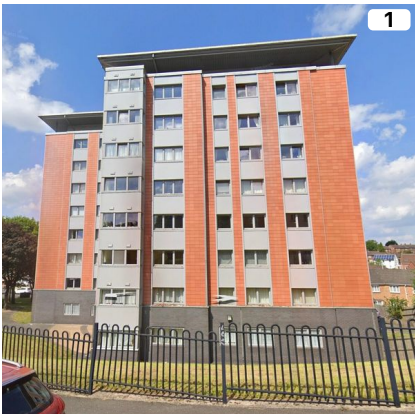


Photos Continued...

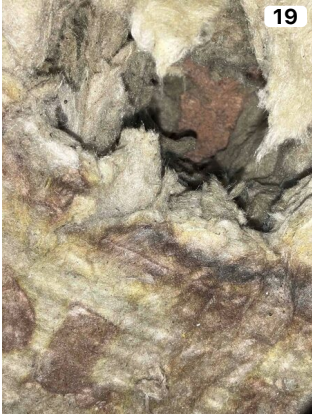



Photos Continued...

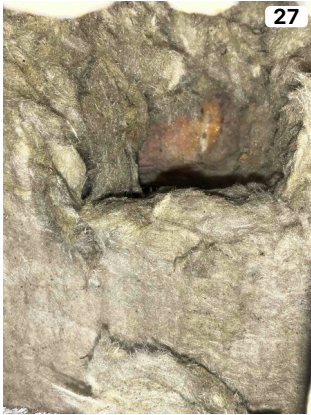

Photos Continued...

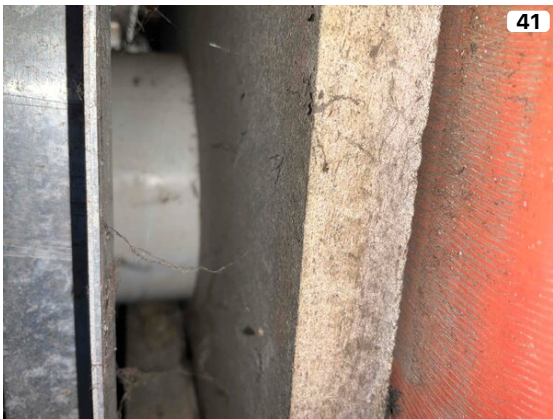


Photos Continued...

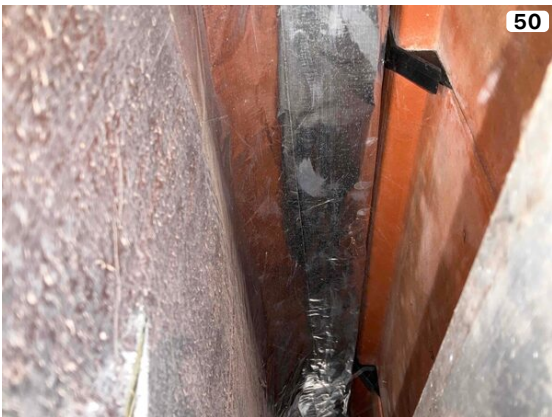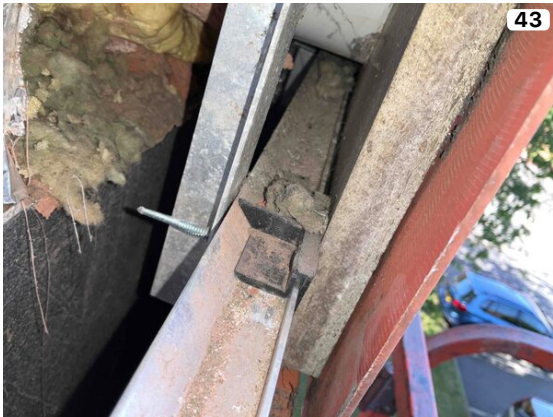

Photos Continued...



Photos Continued...

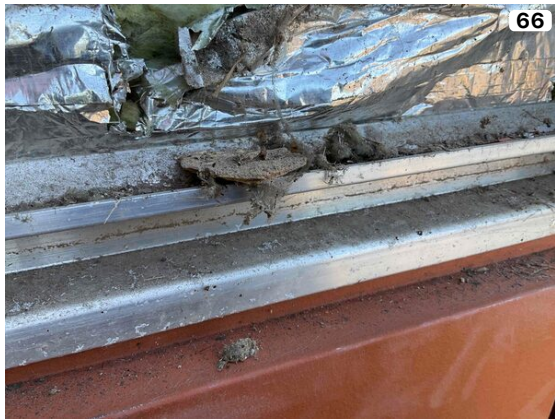


Photos Continued...



Photos Continued...




Photos Continued...

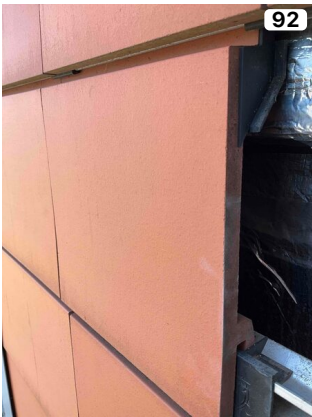



Photos Continued...




Photos Continued...

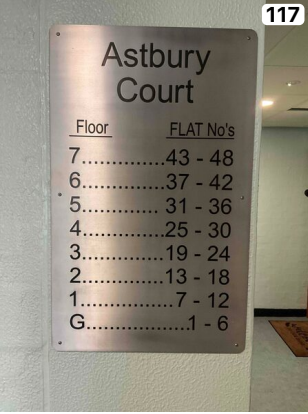

Photos Continued...

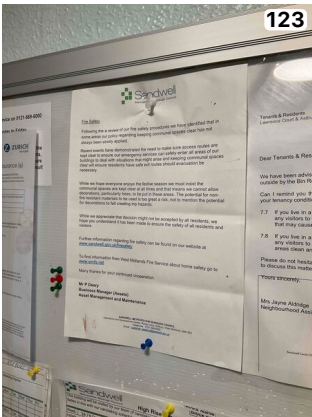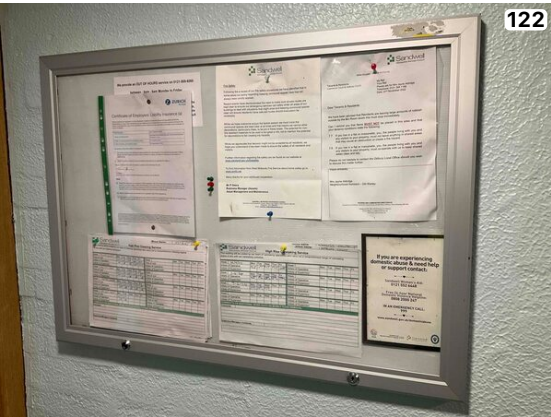

Photos Continued...

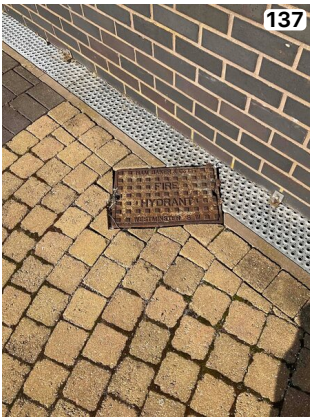



FIRNTEC
BUILDING COMPLIANCE