



FIRNTEC
BUILDING COMPLIANCE

Unit 4a, Darklake View,
Estover
Plymouth
PL6 7TL

Document Version 4
Valid From 12/08/2025
Suggested Review Date 12/08/2030

FIRE RISK APPRAISAL EXTERNAL WALLS

PAGET HOUSE

Sedgeley Road East
Tipton
DY4 7TU

Table of Contents

Cover Page	1
Table of Contents	2
Summary	4
Abbreviation/ Term Definition	5
Statement of Competency	6
Terms of Reference	7
Particulars	7
Limitations	7
Assumptions	7
Statement of Intent	7
Supporting Documents	9
Executive Summary	10
Fire Strategy	13
Wall Constructions	17
Wall Construction: Masonry (Brickwork) (DEHATM)	18
Façade Configuration: XBQRHJ	22
Appendix	26
Asset Information	27
Aerial Perspective: Paget House	31
Elevations	32
Inspections	33
Inspection: ATWTE3	36
Inspection: UZC36D	39
Inspection: T1HJT7	42
Inspection: YIUK64	45
Inspection: T2KEVX	48
Inspection: GJ6YY2	50
Inspection: KQZ688	53
Inspection: 4M4ARC	54
Inspection: FRQIPA	55
Inspection: WN1LAB	57

Table of Contents Continued

Inspection: M71996	60
Inspection: ZM9Y33	61
Attachments & Balconies	62
Attachment: Inset Balcony (9EZISK)	63
External Windows	65
External Window: Top, Mid, Side Hung Casements (CHQ22V)	66
External Doors	67
External Door: Single Leaf Door (GESB5Q)	68
External Door: Single Leaf Door (RA42ZY)	69
Plans & Elevations	70
Photos	73

Summary

Fire Risk Appraisal External Walls

Assessment and Certificate Reference

RB-5KCFG5

Assessed On, By

12/08/2025, James Major (Facade Manager)

Approved / Validated On, By

24/02/2026, Lea Morland

Recommended Review Date

12/08/2030

Produced For the Responsible Person

Sandwell Metropolitan Council

Specification Conforms To

Our own internal quality system.

Assessment Scope

Assessment applies only to the building specified.

Assessed Property

Property Name

Paget House

Property Reference

RB-UA1YD4

Address

Sedgeley Road East

Tipton

DY4 7TU

Assessing Organisation

Firntec Ltd

7 Darklake View, Estover, Plymouth, Devon, PL6 7TL

0345 646 1566 — www.firntec.com

Abbreviation/ Term Definition

- **ACM** Aluminium Composite Material
- **ADB** Approved Document B
- **AOV** Automatic Opening Vent
- **BSA** Building Safety Act 2022
- **Cavity Barrier** Product used to close or separate a concealed space to restrict fire and smoke
- **Close State Cavity Barrier** Cavity Barrier designed to be fitted under compression/friction between inner and outer surfaces of a cavity to seal it
- **Open State Cavity Barrier** Cavity Barrier that is open to allow ventilation/drainage of cavity in open state but closes when a developing fire occurs (e.g., intumescent strip)
- **Combustible** Not classified as A1 OR A2 in accordance with BS EN 13501-1: 2018, and not meeting definitions of non-combustible or limited combustibility
- **Compartmentation** Subdivision of building by fire resisting walls and/or floors for limiting fire spread
- **EPS** Expanded Polystyrene
- **EWS1** External Wall System Fire Valuation Form
- **FB** Fire Barrier - Separating element with fire integrity for a specific time
- **Fire Stop** Barrier seal to close an imperfect fit in design between elements of components to stop the spread of fire
- **FRAEW** Fire Risk Appraisal of External Walls
- **FRA** Fire Risk Assessment
- **FRS** Fire and Rescue Services
- **FSA** Fire Safety Act 2021
- **HPL** High Pressure Laminate
- **HRR** Heat Release Rate
- **MDF** Medium Density Fibre Board (a type of manufactured timber)
- **PIR** Polyisocyanurate Rigid Foam
- **PUR** Polyurethane Foam
- **RP** Responsible Person
- **RRFSO** Regulatory Reform (Fire Safety) Order 2005
- **SFS** Steel Framing System
- **SIB** Secure Information Box

Statement of Competency

Statement of Competency to Carry out a Fire Risk Appraisal of External Wall Construction

Within PAS 9980:2022 it requires that a person conducting the FRAEW are competent to do so in accordance with Annex H and to demonstrate the expected skill sets of competent external wall assessors.

This is our Statement of Competence to carry out a Fire Risk Appraisal of External Wall construction.

We confirm that they have:

- a) Read and understood the commentary and provisions relating to the competence of external wall assessors set out in Section 8 and Annex H of PAS 9980:2022;
- b) Adequate and relevant competence to undertake the FRAEW;
- c) Sufficient knowledge, skills and experience in relation to fire safety of external walls to be able to complete an assessment at the level required;
- d) The relevant skill, knowledge, and experience to manage and interpret the results of intrusive inspections; and
- e) The competence to appraise and assess the nature of external wall construction in terms of fire performance and provide an opinion on the risk.
- f) No conflicts of interest of any kind, other than any which are disclosed in the report.
- g) The conclusions of the report are the author's independent assessment of the risks and remedial actions and have not been influenced in any way by the opinions or actions of others except where stated.

Terms of Reference

Particulars

This FRAEW report follows the guidance in accordance and reference to PAS9980:2022 Fire Risk Appraisal of External Walls construction and cladding of existing blocks of flats – Code of Practice.

Limitations

The FRAEW addresses life safety only in relation to the appraisal of the external walls of the building; and in considering risk, this is only in relation to the threat to the occupants in the building and not in terms of property damage or other potential objectives, such as safety of firefighters.

The FRAEW is not aimed at confirming compliance with building regulations, either at the time of construction, or currently.

The FRAEW cannot provide certainty and being risk-based report, it is, therefore, to a degree, reliant on professional judgement in its assessment and in the conclusions drawn within the report.

The FRAEW report is to be reviewed:

- a) if significant changes/repairs have been made to the external wall; and/or
- b) in the event of a fire incident, if the fire involved the external wall construction; and/or
- c) if there are any circumstances, depending upon the nature of the construction, the extent of available knowledge in relation to the particular materials, components and systems used on the building or the degree of uncertainty over the findings, which suggest review is appropriate. In these cases, the report will include a clear explanation as to why periodic review is necessary and include a suggested review date."

If more definitive information becomes available subsequent to the FRAEW on how particular external wall materials, components and systems behave in fire, or there are changes in the fire performance data relied upon in an FRAEW, such information will be expected to take precedence.

Assumptions

It is understood that the absence of evidence, is not evidence of the absence; therefore, within the FRAEW report suitable caveats or assumptions may be applied in arriving at a risk rating, for example, in relation to:

- a) the extent of sampling carried out.
- b) the accuracy of information upon which it has been necessary to rely, especially where it has not been possible to verify the information through site survey and inspection.
- c) the extent of the content and detail within the report; and
- d) the limitations at the time of the FRAEW of available knowledge on the fire performance of the materials, products and systems forming the external walls of the building.

Any caveats or assumptions made within the report are based on the most onerous and worst-case scenarios.

Statement of Intent

The investigation and writing of this FRAEW report has been commissioned at the clients request in line with PAS9980: 2022, which covers residential buildings of all heights with 2 or more dwellings, including hotels, with the aim to make sure that residents of multi-occupancy buildings are safe.

The Fire Safety Act 2021 also puts a legal responsibility on the responsible person where a building contains two or more sets of domestic premises to identify the building's structure and external walls and any common parts including doors or windows in those walls, and anything attached to the exterior of those walls (including balconies).

Supporting Documents

The following documentation was requested for review prior to our visit. Any provided documentation has been reviewed and considered as part of our findings. The range, quality and reliability of the information contained in the provided documents have been examined and deemed satisfactory for completing this FRAEW report:

Document	Received
Fire Risk Assessment Sandwell Metropolitan Borough Council Fire Risk Assessment	Received

Executive Summary

External Wall Systems and Attachments on the Building

12 areas were inspected to gain data about the building's wall constructions. See the Inspections section of this report for full inspection details.

The table below outlines the ratings of the various wall systems and constructions to the property. Each element is explained in more detail further within this report.

5 Items	Effect	Risk
Wall Construction Masonry (Brickwork) (DEHATM)	Positive	Low
Attachment Inset Balcony (9EZISK)	Positive	Low
External Window Top, Mid, Side Hung Casements (CHQ22V)	Neutral	Low
External Door Single Leaf Door (GESB5Q)	Neutral	Low
External Door Single Leaf Door (RA42ZY)	Neutral	Low

In accordance with the PAS 9980 Guidance, any items of construction which are considered as "Medium Risk" should be subject to periodic review, to ensure that conditions do not change, such that the risk may be upgraded to high, prompting the requirement for remediation.

Risk Factor Analysis

The risk factor analysis is a three-stage process; rating the wall construction fire performance **(1)**, façade configuration **(2)**, and fire strategy/fire hazards **(3)** on a sliding risk scale. The risk scale is expressed as "high", "medium" and "low" in a continuum, left to right, from "high" risk to "low" risk. At the furthest left end of the "high" risk band, the risk is deemed to be the highest, reducing as the risk is positioned to the right of this.

Starting with high as a base line, **Stage 1** rates the fire performance risk factors of the wall construction.

Once fire performance factors have been taken into account, **Stage 2** overlays the risk factors of the façade configuration to determine the effect this has on where the risk now lies on the scale.

The final **Stage 3** overlays the risk factors arising from consideration of the fire strategy and fire hazards (including limitations of fire and rescue service intervention).

Risk Factor Analysis 1

This analysis looks at façade configuration **XBQRHJ** which includes wall construction **DEHATM**.

Conclusion: This wall system is comprised of a double-leaf masonry system that was observed to contain no insulation. The outer leaf was formed of 102mm brickwork, and the inner leaf was formed of 100mm blockwork.

Masonry brickwork is generally considered fire-resistant and can provide significant protection against fire for structural and non-structural elements. Masonry bricks, typically made from clay or concrete, have very high melting points (above 1000°C for clay bricks), making them resistant to fire and heat. Bricks have low thermal conductivity. This helps prevent the spread of fire to adjacent areas and provides a thermal barrier that protects the underlying structure. Masonry walls provide effective fire containment, often preventing fire from spreading between compartments within a building. The thickness and density of the masonry wall determine its fire resistance rating.

As set out in PAS9980, a building whose external walls are composed exclusively of this form of construction is not ordinarily expected to require an FRAEW. However, it is recognised that this form of wall construction might be mixed with other forms of wall construction. This form of construction constitutes the lowest risk form of construction that might be used for external walls, for the following reasons.

- Each leaf of the wall, provided it is formed of masonry/concrete at least 75 mm thick and is generally well constructed, is likely to provide at least 30 min fire resistance.
- The masonry/concrete is likely to be of limited combustibility or better.

Given the above, this form of construction is invariably accepted as:

- not requiring cavity barriers generally, except that cavity closers are needed so that there is no free flow of air through the cavity; and
- being able to accommodate combustible materials within the cavity irrespective of building height

No dedicated cavity barriers were identified within the wall system however it was observed that the floor slab extends to the external surface effectively disrupting the mechanism for vertical fire spread within the cavity.


This wall system forms the primary external wall system of the building and as such is present on all elevations and extends from the ground floor to the full height of the building. It is noted that there are structural openings in the facade, such as windows into the accommodation; however, the non-combustible construction of the wall system is not anticipated to support, sustain, or contribute to fire spread across the external surface of the building.

This building operates a 'Stay Put' evacuation policy. It is anticipated that due to the nature of the building's construction a fire would be contained within the compartment of origin long enough for firefighter intervention to begin or for affected occupants to evacuate if necessary. The building has a single central staircase with lobby protection serving all floors. An AOV was located at the head of the staircase with smoke vents located in the communal corridors to prolong the tenability of the means of escape and to aid internal firefighter intervention. A dry riser is fitted to the building with an outlet on every floor. There is adequate access for the fire service to 3 elevations of the building. The nearest fire station is approximately 1.5 miles away and as such the response to a call out would be expected to be swift.

In the event of a fire;

- a) fire spread is likely to be at a rate within expectations for a building of this height, or at a greater, but nevertheless, tolerable rate, given the circumstances at the building in question; and/or
- b) fire spread is unlikely to give rise to widespread secondary fires resulting in occupants being significantly harmed or prevented from escaping; and/or
- c) fire is unlikely to spread in such a way that the communal means of escape will be compromised before occupants can safely use them to escape; and/or
- d) the fire and rescue service are likely to be able to intervene effectively to enable occupants to reach safety in time.

It is our professional opinion that there is no requirement for remediation of this wall type.



Overall Building Risk Rating



Our professional opinion is that overall this Building represents a Positive PAS9980:2022 Outcome.

Recommended Remediations

No recommended remediations identified.

Recommended Interim Measures

No recommended interim measures identified.

Recommended Enhancements

No recommended enhancements identified.

Fire Strategy

Fire Strategy & Hazard Risk Factors

F.1 Occupancy

General needs housing

Neutral

F.2 Evacuation

Stay put

A 'stay put' policy is adopted for the flats. That is, in the event of a fire in a flat, the occupants of that dwelling will evacuate, having been alerted by their own domestic fire detection and alarm system, and request fire service attendance. All other occupants will remain in their flat unless they are threatened by fire and smoke or are advised to evacuate by the fire service. The 'stay put' evacuation policy relies heavily on adequate compartmentation being provided; fire should not spread from one dwelling to another, including by means of the external fabric of the building

Neutral

Photo Ref. 1, 2, 3

F.3 Escape Route Design

Extended travel distances ≤ 15 m (with supporting smoke control)

Single staircase, with lobby approach

Neutral

Photo Ref. 4, 5, 6, 7

F.4 Compartmentation

Adequate compartmentation in line with the expectations for a block of flats

Photo Ref. 4, 8

Neutral

F.5 Smoke Control

Arrangements in which openable windows, AOVs or inlets and outlets of mechanical systems are of a satisfactory proximity away from combustible cladding; or that fire and smoke spread from the external envelope would be unlikely to compromise the effectiveness of the smoke control system or allow a route for fire spread back into the building

Neutral

F.6 Fire Alarm & Detection

Domestic smoke and heat alarms within flats, Category LD2 or LD3

Neutral

F.7 Fire Suppression

Sprinkler system installed within bin rooms only

Neutral

F.8 - Firefighting Facilities

Adequate access for firefighting vehicles

NOTE This is where access is possible in line with benchmark guidance on access for firefighting vehicles, taking into account the size of the building (floor area), height of the building and whether fire mains are present in the building.

Neutral

Photo Ref. 9

F.9 Rising Mains

Suitable rising main present

Neutral

Photo Ref. 10

F.10 Lifts Used By Firefighters

No dedicated firefighting lift.


Neutral

F.11 Specific Fire Hazards

Vehicle parking on roadways adjacent to building

Neutral

Photos

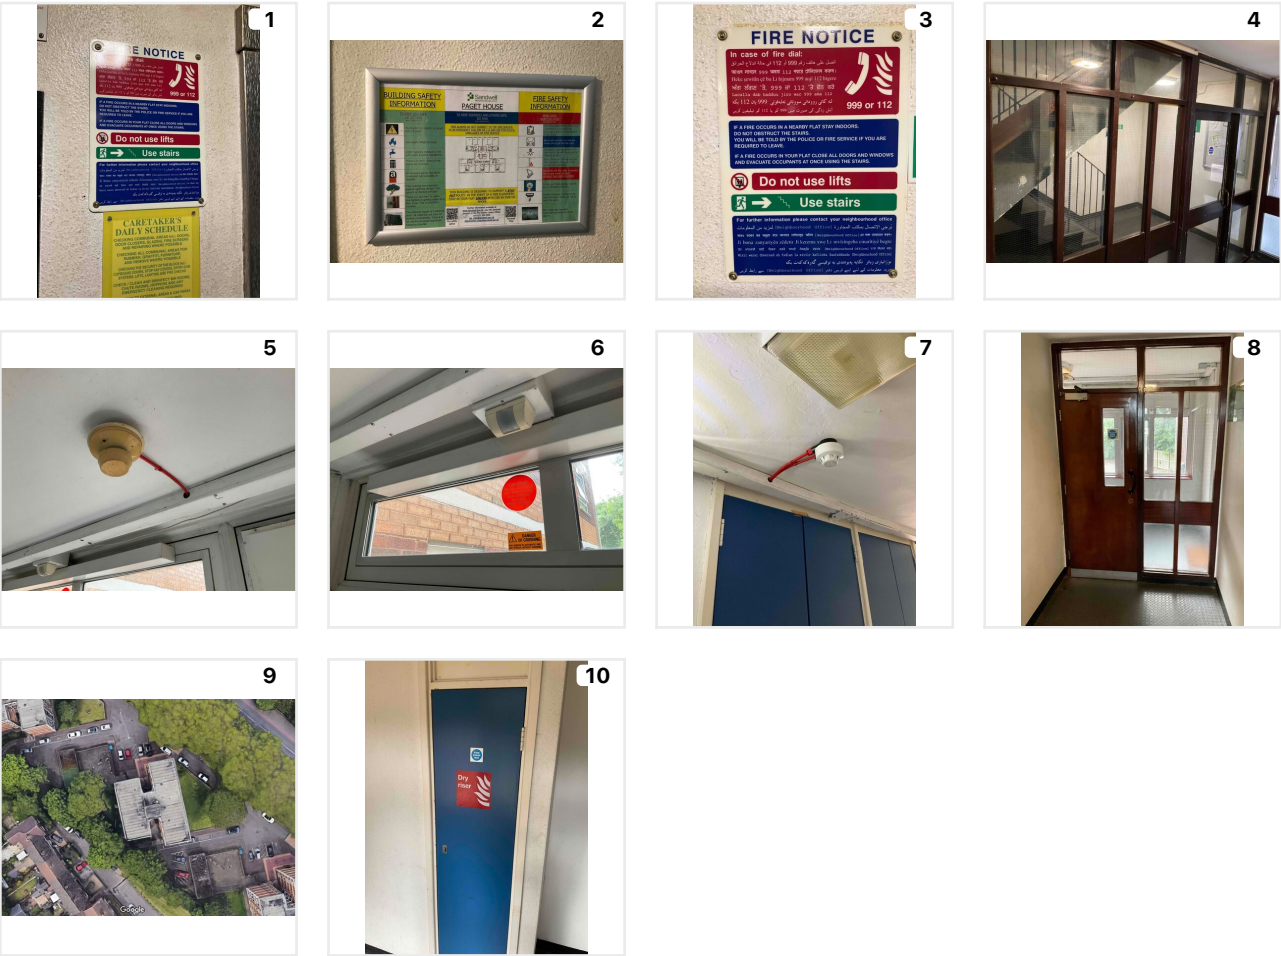

Fire Service Intervention

Event	Seconds	Minutes & Seconds
Initiation to fire detection	120 Seconds	2 Minutes
Actuation Of Fire Detector To Transmission Of Alarm	10 Seconds	10 Seconds
Processing By Central Monitoring Station	60 Seconds	1 Minute
Receipt of call by fire service mobilising control	10 Seconds	10 Seconds
Transmission To Fire Station And Response	60 Seconds	1 Minute
Travelling Time Of Fire Service	420 Seconds	7 Minutes
Arrival Protocol And Entry Preparation Time	180 Seconds	3 Minutes
Firefighting Travel In Firefighting Lift	0 Seconds	—
Firefighter travel to operational bridgehead	135 Seconds	2 Minutes 15 Seconds
Firefighter Travel Walking Up Two Flights Of Stairs To Fire Floor (75 Seconds)	75 Seconds	1 Minute 15 Seconds
Total Time	1,070 Seconds	17 Minutes 50 Seconds

Nearest Fire Station

Tipton Fire Station

Address: Alexandra Road, Tipton, DY4 7NZ approximately 1.3 miles

Wall Constructions

Wall Construction

Build-up

Masonry (Brickwork) (DEHATM)

- External Surface Material (Brickwork)
- Cavity
- Substrate (Original blockwork)

Wall Construction: Masonry (Brickwork)

Construction Reference
DEHATM

This wall construction was identified by wall inspections ATWTE3, UZC36D, T1HJT7, YIUK64, T2KEVX, GJ6YY2, FRQIPA, WN1LAB, M71996, and ZM9Y33. The build-up, cavity barrier, and floor slab information is taken directly from inspection ATWTE3. See the Inspections section of this report for full inspection details.

Construction	Effect	Risk
Masonry (Brickwork) (DEHATM)	Positive	Low

Build-Up

3 Elements	Thickness/Depth	Material	Rating (BS EN13501)
External Surface Material	102mm	Brickwork	A1 - Non-Combustible
Cavity	100mm		
Substrate		Original blockwork	A1 - Non-Combustible

Cavity Barriers

1 Cavity Barrier	Material
Horizontal Cavity Barrier	Concrete

Floor Slab

Reinforced concrete

Fire Performance

K.1 General

Materials with a calorific value (gross heat of combustion) of ≤ 3 MJ/kg

Positive

K.2 External Surfaces

Class A1/A2

Positive

K.3 Facings/Cladding Panels

Low HRR

Positive

K.4 Panel Construction

Not Applicable

K.5 Cavities

Facings into the cavity at least Class A2.

Floor slabs extend to external surface, providing horizontal compartmentation.

Positive

K.6 Insulation

No insulation

Positive

K.7 Substrate

Masonry, >75 mm thick

Positive

K.8 Sheathing Boards

Not Applicable

K.9 Insulated Core Panels

Not Applicable

K.10 ETICS

Not Applicable

K.11 Infill / Spandrel Panels

Not Applicable

K.12 Internal Finishes

Plasterboard

Note: The plasterboard can not be confirmed to be installed as per the manufacturers instructions or ensure its method of fixing

Neutral

PAS Standard Benchmark

L7 Benchmark

DOUBLE SKIN MASONRY

As set out previously in this PAS, a building whose external walls are composed exclusively of this form of construction is not ordinarily expected to require an FRAEW. However, it is recognized that this form of wall construction might be mixed with other forms of wall construction.

This form of construction constitutes the lowest risk form of construction that might be used for external walls, for the following reasons.

- Each leaf of the wall, provided it is formed of masonry/concrete at least 75 mm thick and is generally well constructed, is likely to provide at least 30 min fire resistance.
- The masonry/concrete is likely to be of limited combustibility or better.

Given the above, this form of construction is invariably accepted as:

- not requiring cavity barriers generally, except that cavity closers are needed so that there is no free flow of air through the cavity; and
- being able to accommodate combustible materials within the cavity irrespective of building height.

This is illustrated in Diagram 8.2 in ADB Volume 1:2019 [8]. The equivalent diagram in Volume 2:2019 [9] is Diagram 9.2.

BR135 Benchmark

We have compared this external wall type to the cladding systems found on the BR135 database and we did not find a cladding system with the configuration and components that would constitute an exact match to what our inspections found on the Property. Therefore, a BR135 benchmark would not be applicable for this external wall type

Façade Configuration: XBQRHJ

Items in Façade

5 Items

	Effect	Risk
Wall Construction Masonry (Brickwork) (DEHATM)	Positive	Low
Attachment Inset Balcony (9EZISK)	Positive	Low
External Door Single Leaf Door (GESB5Q)	Neutral	Low
External Door Single Leaf Door (RA42ZY)	Neutral	Low
External Window Top, Mid, Side Hung Casements (CHQ22V)	Neutral	Low

Façade Configuration Risk Factors

N.1 Building Height

<18 m

Neutral

N.2 Height of Base of Cladding (Above Ground)

<2 m

NOTE At this height, the likelihood of a fire originating externally (e.g. involving a parked vehicle or waste skip started either accidentally or deliberately) igniting the cladding is highly likely.

Although the masonry system present on this building begins on the ground floor, its non-combustible nature means that it is highly unlikely to become ignited.

Neutral

N.3 Extent of Cladding

Entire façade covered.

The external leaf of this facade is non-combustible and therefore not anticipated to support, sustain, or contribute to fire spread across the external surface of the building.

Neutral

N.4 Cavities & Openings

Cavity not continuous, due to façade being only partially clad or broken by building features:

- projecting floor slabs that divide part of the wall and isolate sections of cavity from each other; and
- walls that project out or are set back, such as to limit the vertical extent of cavities)

Positive

N.5 Infill / Spandrel Panels

Not Applicable

N.6 Setbacks - Combustible Cladding Setback from Wall Edge

Not Applicable

N.7 Overhangs & Projections

Not Applicable

N.8 Proximity to Windows and Other Openings to the Accommodation

Horizontally adjacent to windows and openings, and vertically in line with such openings, such that the facade will be subject to direct flame impingement and smoke spread.

NOTE: Although this wall type encompasses windows into the accommodation, this wall type is formed of non-combustible materials that are not anticipated to support, sustain, or contribute to fire spread across the external surface of the building.

Neutral

N.9 Presence of vents or other openings for services in the Façade

Where vents pass through a cavity, either:

- the cavity does not include combustible materials; or
- the cavity is faced on either side by brick or concrete at least 75 mm thick and any combustible insulation in the cavity is not thermoplastic

Positive

N10. Proximity of Combustible Elements of a Façade to Escape Route Windows & Other Openings

No combustible elements

Positive

N.11 Attachments

Non-combustible open balconies

(Where these extend along a façade, they have the potential both to:

- interrupt a cavity; and
- deflect flames away from the building and away from the façade)

Positive

N.12 Proximity of Combustible Elements of a Façade to a Neighbouring Building

Windows or other openings in adjacent or abutting neighbouring buildings are sufficiently distanced that direct flame impingement from a fire in the neighbouring building is unforeseeable

Neutral

Risk Factor Analysis

Conclusion: This wall system is comprised of a double-leaf masonry system that was observed to contain no insulation. The outer leaf was formed of 102mm brickwork, and the inner leaf was formed of 100mm blockwork.

Masonry brickwork is generally considered fire-resistant and can provide significant protection against fire for structural and non-structural elements. Masonry bricks, typically made from clay or concrete, have very high melting points (above 1000°C for clay bricks), making them resistant to fire and heat. Bricks have low thermal conductivity. This helps prevent the spread of fire to adjacent areas and provides a thermal barrier that protects the underlying structure. Masonry walls provide effective fire containment, often preventing fire from spreading between compartments within a building. The thickness and density of the masonry wall determine its fire resistance rating.

As set out in PAS9980, a building whose external walls are composed exclusively of this form of construction is not ordinarily expected to require an FRAEW. However, it is recognised that this form of wall construction might be mixed with other forms of wall construction. This form of construction constitutes the lowest risk form of construction that might be used for external walls, for the following reasons.

- Each leaf of the wall, provided it is formed of masonry/concrete at least 75 mm thick and is generally well constructed, is likely to provide at least 30 min fire resistance.
- The masonry/concrete is likely to be of limited combustibility or better.

Given the above, this form of construction is invariably accepted as:

- not requiring cavity barriers generally, except that cavity closers are needed so that there is no free flow of air through the cavity; and
- being able to accommodate combustible materials within the cavity irrespective of building height

No dedicated cavity barriers were identified within the wall system however it was observed that the floor slab extends to the external surface effectively disrupting the mechanism for vertical fire spread within the cavity.


This wall system forms the primary external wall system of the building and as such is present on all elevations and extends from the ground floor to the full height of the building. It is noted that there are structural openings in the facade, such as windows into the accommodation; however, the non-combustible construction of the wall system is not anticipated to support, sustain, or contribute to fire spread across the external surface of the building.

This building operates a 'Stay Put' evacuation policy. It is anticipated that due to the nature of the building's construction a fire would be contained within the compartment of origin long enough for firefighter intervention to begin or for affected occupants to evacuate if necessary. The building has a single central staircase with lobby protection serving all floors. An AOV was located at the head of the staircase with smoke vents located in the communal corridors to prolong the tenability of the means of escape and to aid internal firefighter intervention. A dry riser is fitted to the building with an outlet on every floor. There is adequate access for the fire service to 3 elevations of the building. The nearest fire station is approximately 1.5 miles away and as such the response to a call out would be expected to be swift.

In the event of a fire;

- a) fire spread is likely to be at a rate within expectations for a building of this height, or at a greater, but nevertheless, tolerable rate, given the circumstances at the building in question; and/or
- b) fire spread is unlikely to give rise to widespread secondary fires resulting in occupants being significantly harmed or prevented from escaping; and/or
- c) fire is unlikely to spread in such a way that the communal means of escape will be compromised before occupants can safely use them to escape; and/or
- d) the fire and rescue service are likely to be able to intervene effectively to enable occupants to reach safety in time.

It is our professional opinion that there is no requirement for remediation of this wall type.



APPENDIX

Asset Information

Client Name

Sandwell Metropolitan Council

Client Address

Sandwell Council House, Freeth Street, Oldbury B69 3DE

Fire Alarm System

There is no BS5839 Fire detection/alarm system provided in the common areas of the building. Smoke detection within the block has been installed in the communal lobbies above the ground floor and is linked to the automatic opening smoke ventilation system. Smoke / Fire detection to individual flats assessed is fitted to an LD1 or LD2 standard.

Emergency Lighting

Installed in communal parts

Emergency Lighting

Emergency lighting appears to conform to the requirements of BS5266-1 design standard. The system appears to provide adequate coverage and be in good working order (indicator lights active on luminaires). Luminaires appear to be correctly sited and appear to provide adequate lighting.

Portable Fire Fighting Equipment

Portable Fire Fighting Equipment installed within staff only / Restricted areas of the building

Portable Fire Fighting Equipment

A portable fire extinguisher (CO2) is located within the lift motor room and is serviced annually.

Smoke Control

Natural smoke control

Smoke Control

The stairs and/or lobbies are provided with adequate permanent or manually operated ventilation openings for the control of smoke. Manual openable windows within the stairwell and the stairs and lobbies are provided with an automatic smoke ventilation system

Suppression Systems

Partial sprinkler system installed (Detailed in Description)

Suppression System

Sprinkler system installed within bin rooms only

Fire Fighting Facilities

Dry Riser

Fire Fighting Facilities

Dry riser outlets were located on each floor within the firefighting lobby area, ensuring accessible water supply for firefighting operations. This placement allows for efficient connection of firefighting hoses, providing vital water access to emergency services during fire incidents across all floor levels.

Access for fire-fighting vehicles

Adequate access for firefighting vehicles

NOTE This is where access is possible in line with benchmark guidance on access for firefighting vehicles from Approved Document B, taking into account the size of the building (floor area), height of the building and whether fire mains are present in the building.

Fire Hydrant Location/ Water Supply

Public fire hydrant are available. The nearest fire hydrant is 25m from the building on the corner of the footpath adjacent to Paget House as detailed on the orientation plan provided in the on arrival information.

Public fire hydrants can be located: <https://dataservices.riscauthority.co.uk/map/index>

Housekeeping

Good standard. Means of escape clear. Refuse stored appropriately

Secure Information Boxes

Secure information box (SIB) installed

Signage

Appropriate signage installed throughout premises

Property Type

Residential

Building Era / Age

Known Build Date

Known Build Date

1962

Guidance Applicable At Time Of Construction

Model Byelaws 1953

Building Height

Overall Building Height Approximately 18m

Highest Occupied Floor Level 15m

(calculated at 3m per floor as per PAS 9980-2022 section 3.1.22)

Number of Storeys (Ground and above)

6

Number of Flats

30

Structural Wall Material

Concrete / Brick

Structural Stairs Material

Concrete

Exterior Cladding

No Exterior Cladding

Carpark

External/Outdoor Carpark

Employees

None

Approx number of Residents

60

Residents (Extended)

Assumed to be two residents per flat (Exact numbers not known)

Visitors

Not Known

Lone Workers

None

Young Persons Employed in the Premises

None

Flat Types

Single Storey

Structural Floor Material

Reinforced Concrete

Construction (Details)

Traditional concrete frame and brick construction

Electronic Entrance System

Yes

Residents

Yes

People With Reduced Mobility

Not Known

Escapes & Exits

There are sufficient fire exits from the premises of suitable width and within acceptable travel distances. These will allow all persons in the premises to evacuate safely in the event of fire. Emergency exits open outwards in escape

direction.

Number Of Internal Escape Stairs

1

External Means Of Escape

None Present

Evacuation Chairs Installed

No

Stairwells Protected / Lobbied

Yes

Current Evacuation Strategy

Stay Put

Current Stay Put Strategy Description

The current evacuation strategy is Stay Put as denoted by the fire action notices displayed in the common area.

Number Of Final Exits

2

Types Of Lifts Installed

Passenger

Refuge Points Present

No

Flat Doors Open Onto Stairs


No

Aerial Perspective: Paget House

Aerial Perspective (picture sourced from Google Earth)



Elevations

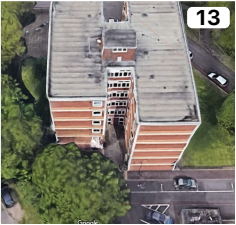
Photo	Name	No. of Storeys	Features
 A photograph of the East Elevation of Paget House, a six-story brick building with multiple windows and balconies. A small white box with the number '11' is in the top right corner of the photo.	East Elevation	6 Storeys	• Private Balconies Inset Stacked
 A photograph of the North Elevation of Paget House, a six-story brick building with a central entrance and multiple windows. A small white box with the number '12' is in the top right corner of the photo.	North Elevation	6 Storeys	• Escape Route Exit
 An aerial photograph of the South Elevation of Paget House, showing the building's footprint and surrounding greenery. A small white box with the number '13' is in the top right corner of the photo.	South Elevation	6 Storeys	

Inspections

Elevation Location


Inspection

Elements

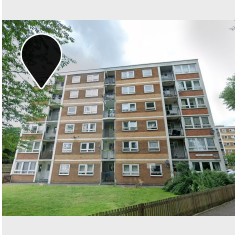


Inspection: ATWTE3
East Elevation
Compartment Floor Junction

- External Surface Material (Brickwork)
- Cavity
- Substrate (Original blockwork)

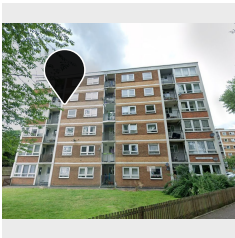


Inspection: UZC36D
East Elevation
Compartment Floor and Wall Junction
Interface

- External Surface Material (Brickwork)
- Cavity
- Substrate (Original blockwork)

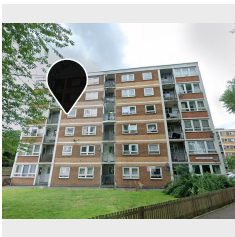


Inspection: T1HJT7
East Elevation
Aperture Opening

- External Surface Material (Brickwork)
- Cavity
- Substrate (Original blockwork)

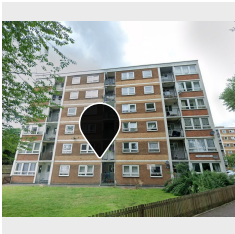


Inspection: YIUK64
East Elevation
Compartment Floor and Wall Junction
Interface

- External Surface Material (Brickwork)
- Cavity
- Substrate (Original blockwork)

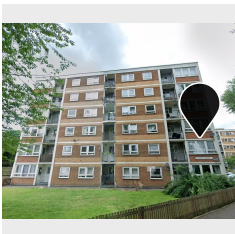


Inspection: T2KEVX
East Elevation
Compartment Floor Junction

- External Surface Material (Brickwork)
- Cavity
- Substrate (Original blockwork)

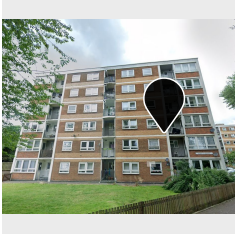Elevation Location**Inspection****Elements****Inspection: GJ6YY2**


East Elevation
Compartment Floor and Wall Junction
Interface

- External Surface Material (Brickwork)
- Cavity
- Substrate (Original brickwork)

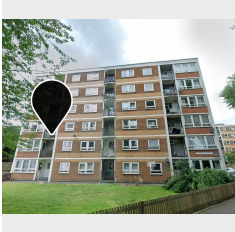**Inspection: KQZ688**

East Elevation
Balcony Inspection

- External Surface Material (Reinforced concrete extension of floor slab)

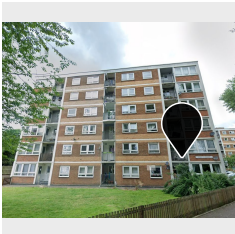**Inspection: 4M4ARC**


East Elevation
Balcony Inspection

- Substrate (Reinforced concrete extension of floor slab)

**Inspection: FRQIPA**


North Elevation
Compartment Floor Junction

- External Surface Material (Brickwork)
- Cavity
- Substrate (Original brickwork)

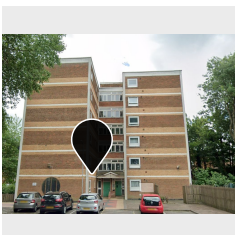**Inspection: WN1LAB**


North Elevation
Compartment Floor Junction

- External Surface Material (Brickwork)
- Cavity
- Substrate (Original brickwork)

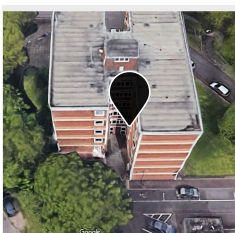**Inspection: M71996**

South Elevation
Compartment Floor and Wall Junction
Interface

No elements identified

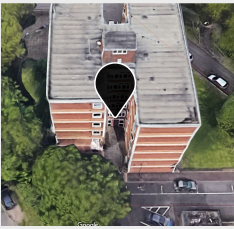

Inspection: ZM9Y33
South Elevation
Compartment Floor Junction

No elements identified

Inspection: ATWTE3

Elevation • Location
East Elevation • Compartment Floor Junction



Name/Summary

Masonry (Brickwork)

Proposed Inspection

The purpose of the intrusive survey will consist of the visual and intrusive inspections of the identified systems and attachments to determine the through wall construction.

The Engineer will be looking to determine the:

- a) External Leaf (Identify the material and Euroclass)
- b) Cavities (if a cavity is present and if so the depth and extent)
- c) Insulation (identify the material and Euroclass)
- d) Sheathing Board (the presence of any Sheathing Board)
- e) Membranes (identify their presence and where possible manufacturer)
- f) Substrates (the means in which the façade is attached to the building)
- g) Cavity Barriers (Horizontally, Vertically, Around Openings)

The external inspection is undertaken by either using an approximate 25mm – 150mm bore in a discreet location or the removal of the external surface material. The engineer will then gather the external walls construction from external to internal.

The materials are then measured and observed in there construction along with photographic evidence. Upon completion the removed material is placed back into the opening and sealed to a fire safe condition but will not conduct any decorative repairs.

Build-Up

3 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	102mm	Brickwork	14	A1 - Non-Combustible
Cavity	100mm		15	
Substrate		Original blockwork	16	A1 - Non-Combustible

Cavity Barriers



1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Concrete	17

Cavity closed horizontally by the concrete floor slab

Floor Slab

Reinforced concrete

Build-up Photos

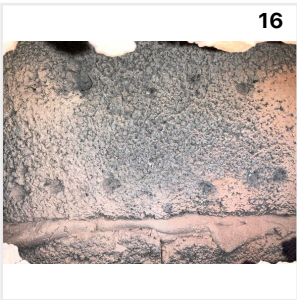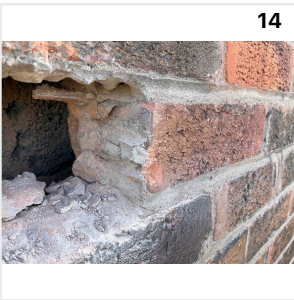

Cavity Barrier Photos



Inspection Photos



Inspection: UZC36D

Elevation • Location
East Elevation • Compartment Floor and Wall Junction Interface



Name/Summary

Masonry (Brickwork)

Proposed Inspection

The purpose of the intrusive survey will consist of the visual and intrusive inspections of the identified systems and attachments to determine the through wall construction.

The Engineer will be looking to determine the:

- a) External Leaf (Identify the material and Euroclass)
- b) Cavities (if a cavity is present and if so the depth and extent)
- c) Insulation (identify the material and Euroclass)
- d) Sheathing Board (the presence of any Sheathing Board)
- e) Membranes (identify their presence and where possible manufacturer)
- f) Substrates (the means in which the façade is attached to the building)
- g) Cavity Barriers (Horizontally, Vertically, Around Openings)

The external inspection is undertaken by either using an approximate 25mm – 150mm bore in a discreet location or the removal of the external surface material. The engineer will then gather the external walls construction from external to internal.

The materials are then measured and observed in there construction along with photographic evidence. Upon completion the removed material is placed back into the opening and sealed to a fire safe condition but will not conduct any decorative repairs.

NOTE: Compartment junction has been assumed. Please relocate test location to compartment junction where possible.

Build-Up

3 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	102mm	Brickwork	20	A1 - Non-Combustible
Cavity	60mm		21	
Substrate		Original blockwork	22	A1 - Non-Combustible

Cavity Barriers


1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Concrete	23

Cavity closed horizontally by the concrete floor slab

Floor Slab

Reinforced concrete

Build-up Photos

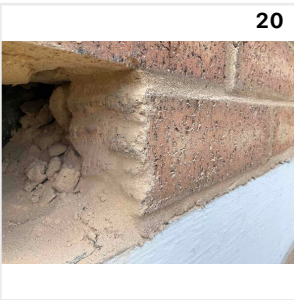

Cavity Barrier Photos



Inspection Photos



Inspection: T1HJT7

Elevation • Location
East Elevation • Aperture Opening



Name/Summary

Masonry (Brickwork)

Proposed Inspection

The purpose of the intrusive survey will consist of the visual and intrusive inspections of the identified systems and attachments to determine the through wall construction.

The Engineer will be looking to determine the:

- a) External Leaf (Identify the material and Euroclass)
- b) Cavities (if a cavity is present and if so the depth and extent)
- c) Insulation (identify the material and Euroclass)
- d) Sheathing Board (the presence of any Sheathing Board)
- e) Membranes (identify their presence and where possible manufacturer)
- f) Substrates (the means in which the façade is attached to the building)
- g) Cavity Barriers (Horizontally, Vertically, Around Openings)

The external inspection is undertaken by either using an approximate 25mm – 150mm bore in a discreet location or the removal of the external surface material. The engineer will then gather the external walls construction from external to internal.

The materials are then measured and observed in there construction along with photographic evidence. Upon completion the removed material is placed back into the opening and sealed to a fire safe condition but will not conduct any decorative repairs.

Build-Up

3 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	102mm	Brickwork	25	A1 - Non-Combustible
Cavity	70mm		26	
Substrate		Original blockwork	27	A1 - Non-Combustible

Cavity Barriers

1 Cavity Barrier	Material	Photo Ref.
Window Aperture	Blockwork	28
Cavity closed at the window opening		

Floor Slab

Reinforced concrete

Build-up Photos



Cavity Barrier Photos



Inspection Photos



Inspection: YIUK64

Elevation • Location
East Elevation • Compartment Floor and Wall Junction Interface



Name/Summary

Masonry (Brickwork)

Proposed Inspection

The purpose of the intrusive survey will consist of the visual and intrusive inspections of the identified systems and attachments to determine the through wall construction.

The Engineer will be looking to determine the:

- a) External Leaf (Identify the material and Euroclass)
- b) Cavities (if a cavity is present and if so the depth and extent)
- c) Insulation (identify the material and Euroclass)
- d) Sheathing Board (the presence of any Sheathing Board)
- e) Membranes (identify their presence and where possible manufacturer)
- f) Substrates (the means in which the façade is attached to the building)
- g) Cavity Barriers (Horizontally, Vertically, Around Openings)

The external inspection is undertaken by either using an approximate 25mm – 150mm bore in a discreet location or the removal of the external surface material. The engineer will then gather the external walls construction from external to internal.

The materials are then measured and observed in there construction along with photographic evidence. Upon completion the removed material is placed back into the opening and sealed to a fire safe condition but will not conduct any decorative repairs.

NOTE: Compartment junction has been assumed. Please relocate test location to compartment junction where possible.

Build-Up

3 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	102mm	Brickwork	30	A1 - Non-Combustible
Cavity	60mm		31	
Substrate		Original blockwork	32	A1 - Non-Combustible

Cavity Barriers


1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Concrete	33

Cavity closed horizontally by the concrete floor slab

Floor Slab

Reinforced concrete

Build-up Photos

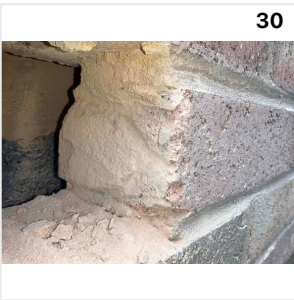

Cavity Barrier Photos



Inspection Photos



Inspection: T2KEVX

Elevation • Location
East Elevation • Compartment Floor Junction



Name/Summary

Masonry (Brickwork)

Proposed Inspection

The purpose of the intrusive survey will consist of the visual and intrusive inspections of the identified systems and attachments to determine the through wall construction.

The Engineer will be looking to determine the:

- a) External Leaf (Identify the material and Euroclass)
- b) Cavities (if a cavity is present and if so the depth and extent)
- c) Insulation (identify the material and Euroclass)
- d) Sheathing Board (the presence of any Sheathing Board)
- e) Membranes (identify their presence and where possible manufacturer)
- f) Substrates (the means in which the façade is attached to the building)
- g) Cavity Barriers (Horizontally, Vertically, Around Openings)

The external inspection is undertaken by either using an approximate 25mm – 150mm bore in a discreet location or the removal of the external surface material. The engineer will then gather the external walls construction from external to internal.

The materials are then measured and observed in there construction along with photographic evidence. Upon completion the removed material is placed back into the opening and sealed to a fire safe condition but will not conduct any decorative repairs.

Build-Up


3 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	102mm	Brickwork	35, 36	A1 - Non-Combustible
Cavity	100mm		37	
Substrate		Original blockwork	38	A1 - Non-Combustible

Cavity Barriers

1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Concrete	39

Cavity closed horizontally by the concrete floor slab


Build-up Photos

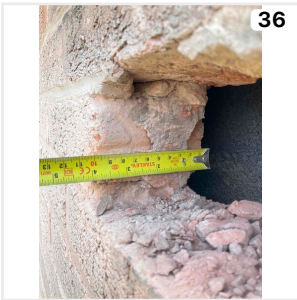

Cavity Barrier Photos



Inspection Photos

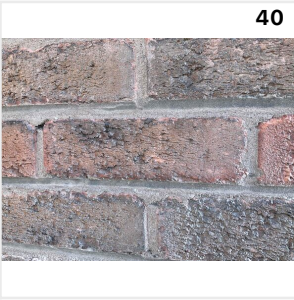

Inspection: GJ6YY2

Elevation • Location
East Elevation • Compartment Floor and Wall Junction Interface



Name/Summary

Masonry (Brickwork)

Proposed Inspection

The purpose of the intrusive survey will consist of the visual and intrusive inspections of the identified systems and attachments to determine the through wall construction.

The Engineer will be looking to determine the:

- a) External Leaf (Identify the material and Euroclass)
- b) Cavities (if a cavity is present and if so the depth and extent)
- c) Insulation (identify the material and Euroclass)
- d) Sheathing Board (the presence of any Sheathing Board)
- e) Membranes (identify their presence and where possible manufacturer)
- f) Substrates (the means in which the façade is attached to the building)
- g) Cavity Barriers (Horizontally, Vertically, Around Openings)

The external inspection is undertaken by either using an approximate 25mm – 150mm bore in a discreet location or the removal of the external surface material. The engineer will then gather the external walls construction from external to internal.

The materials are then measured and observed in there construction along with photographic evidence. Upon completion the removed material is placed back into the opening and sealed to a fire safe condition but will not conduct any decorative repairs.

NOTE: Compartment junction has been assumed. Please relocate test location to compartment junction where possible.

Build-Up

3 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material		Brickwork	42	A1 - Non-Combustible
Cavity	60mm			
Substrate		Original brickwork	43	A1 - Non-Combustible

Cavity Barriers


1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Concrete	44

Cavity closed horizontally by the concrete floor slab


Floor Slab

Reinforced concrete

Build-up Photos

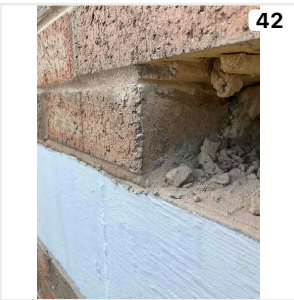

Cavity Barrier Photos

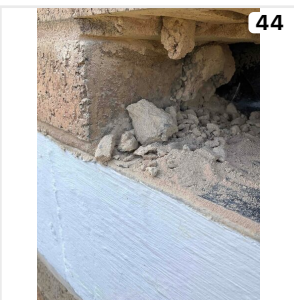

Inspection Photos



Inspection: KQZ688

Elevation • Location
East Elevation • Balcony Inspection



Name/Summary

Balcony

Description

Refer to balconies section

Build-Up

1 Element	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	Reinforced concrete extension of floor slab		A1 - Non-Combustible

Floor Slab

Reinforced concrete

Inspection: 4M4ARC

Elevation • Location
East Elevation • Balcony Inspection



Name/Summary

Balcony

Description

Refer to balconies section

Build-Up

1 Element	Material	Photo Ref.	Rating (BS EN13501)
-----------	----------	------------	---------------------

Substrate	Reinforced concrete extension of floor slab	
-----------	---	--

A1 - Non-Combustible

Refer to balconies section

Floor Slab

Reinforced concrete

Inspection: FRQIPA

Elevation • Location
North Elevation • Compartment Floor Junction



Name/Summary

Masonry (Brickwork)

Proposed Inspection

The purpose of the intrusive survey will consist of the visual and intrusive inspections of the identified systems and attachments to determine the through wall construction.

The Engineer will be looking to determine the:

- a) External Leaf (Identify the material and Euroclass)
- b) Cavities (if a cavity is present and if so the depth and extent)
- c) Insulation (identify the material and Euroclass)
- d) Sheathing Board (the presence of any Sheathing Board)
- e) Membranes (identify their presence and where possible manufacturer)
- f) Substrates (the means in which the façade is attached to the building)
- g) Cavity Barriers (Horizontally, Vertically, Around Openings)

The external inspection is undertaken by either using an approximate 25mm – 150mm bore in a discreet location or the removal of the external surface material. The engineer will then gather the external walls construction from external to internal.

The materials are then measured and observed in there construction along with photographic evidence. Upon completion the removed material is placed back into the opening and sealed to a fire safe condition but will not conduct any decorative repairs.

Build-Up



3 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	102mm	Brickwork	46, 47	A1 - Non-Combustible
Cavity	90mm		48	
Substrate		Original brickwork	49	A1 - Non-Combustible

Cavity Barriers

1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Concrete	50

Cavity closed horizontally by the concrete floor slab

Build-up Photos

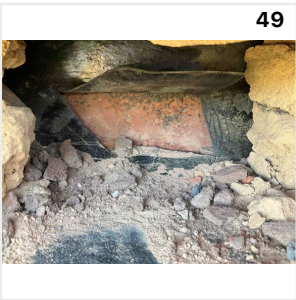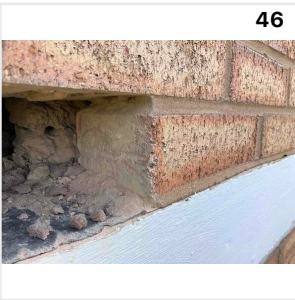

Cavity Barrier Photos



Inspection Photos



Inspection: WN1LAB

Elevation • Location
North Elevation • Compartment Floor Junction



Name/Summary

Masonry (Brickwork)

Proposed Inspection

The purpose of the intrusive survey will consist of the visual and intrusive inspections of the identified systems and attachments to determine the through wall construction.

The Engineer will be looking to determine the:

- a) External Leaf (Identify the material and Euroclass)
- b) Cavities (if a cavity is present and if so the depth and extent)
- c) Insulation (identify the material and Euroclass)
- d) Sheathing Board (the presence of any Sheathing Board)
- e) Membranes (identify their presence and where possible manufacturer)
- f) Substrates (the means in which the façade is attached to the building)
- g) Cavity Barriers (Horizontally, Vertically, Around Openings)

The external inspection is undertaken by either using an approximate 25mm – 150mm bore in a discreet location or the removal of the external surface material. The engineer will then gather the external walls construction from external to internal.

The materials are then measured and observed in there construction along with photographic evidence. Upon completion the removed material is placed back into the opening and sealed to a fire safe condition but will not conduct any decorative repairs.

Build-Up

3 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
External Surface Material	102mm	Brickwork	53, 54	A1 - Non-Combustible
Cavity	70mm		55	
Substrate		Original brickwork	56	A1 - Non-Combustible

Cavity Barriers


1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Concrete	57

Cavity closed horizontally by the concrete floor slab

Floor Slab

Reinforced concrete

Build-up Photos

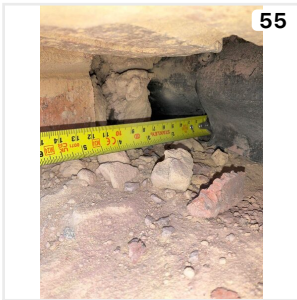

Cavity Barrier Photos




Inspection Photos



Inspection: M71996

Elevation • Location

South Elevation • Compartment Floor and Wall Junction Interface

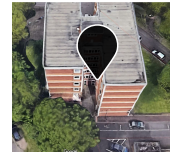

Name/Summary

Masonry (Brickwork)

Proposed Inspection

The purpose of the intrusive survey will consist of the visual and intrusive inspections of the identified systems and attachments to determine the through wall construction.

The Engineer will be looking to determine the:

- a) External Leaf (Identify the material and Euroclass)
- b) Cavities (if a cavity is present and if so the depth and extent)
- c) Insulation (identify the material and Euroclass)
- d) Sheathing Board (the presence of any Sheathing Board)
- e) Membranes (identify their presence and where possible manufacturer)
- f) Substrates (the means in which the façade is attached to the building)
- g) Cavity Barriers (Horizontally, Vertically, Around Openings)

The external inspection is undertaken by either using an approximate 25mm – 150mm bore in a discreet location or the removal of the external surface material. The engineer will then gather the external walls construction from external to internal.


The materials are then measured and observed in there construction along with photographic evidence.

Upon completion the removed material is placed back into the opening and sealed to a fire safe condition but will not conduct any decorative repairs.

Inspection: ZM9Y33

Elevation • Location

South Elevation • Compartment Floor Junction

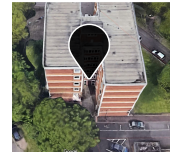

Name/Summary

Masonry (Brickwork)

Proposed Inspection

The purpose of the intrusive survey will consist of the visual and intrusive inspections of the identified systems and attachments to determine the through wall construction.

The Engineer will be looking to determine the:

- a) External Leaf (Identify the material and Euroclass)
- b) Cavities (if a cavity is present and if so the depth and extent)
- c) Insulation (identify the material and Euroclass)
- d) Sheathing Board (the presence of any Sheathing Board)
- e) Membranes (identify their presence and where possible manufacturer)
- f) Substrates (the means in which the façade is attached to the building)
- g) Cavity Barriers (Horizontally, Vertically, Around Openings)

The external inspection is undertaken by either using an approximate 25mm – 150mm bore in a discreet location or the removal of the external surface material. The engineer will then gather the external walls construction from external to internal.

The materials are then measured and observed in there construction along with photographic evidence.

Upon completion the removed material is placed back into the opening and sealed to a fire safe condition but will not conduct any decorative repairs.

Attachments & Balconies

Photo

Attachment



Inset Balcony (9EZISK)
Configuration: Stacked, Inset
Size: Private balcony spanning only a single compartment

Attachment: Inset Balcony

Attachment Reference
9EZISK

Details

Configuration

Stacked, Inset

Size

Private balcony spanning only a single compartment

Framework/Structure

Reinforced concrete framework extension of the floor slab

Handrail

Steel (confirmed via magnet)

Balustrade

Steel (confirmed via magnet)

Soffit

Concrete

Details

Visual observations only no access to private balconies

L6 Benchmark

Balconies -

Balconies are defined in BS 8579. However, for the purpose of this PAS and the manner in which balconies impact external fire behaviour, balconies fall into one of three categories:

- a) Those which fall entirely within the curtilage of the building structure (i.e. they are built on the slab and appear inset into the building when observed from outside). They might be enclosed to an extent and might effectively be made fully enclosed (sometimes referred to as a "winter garden"). The extent of enclosure needs to be considered in light of whether, from a fire perspective, the space can be treated as part of the outside or whether it is in effect a compartment (i.e. subject to compartment fire behaviour);
- b) Those which project beyond the main building structure but do so on an extension of the floor slab. They provide an advantage in that their construction matches that of the compartment floor within the building, and can deflect fire/smoke plumes away from the building; and
- c) Those which project beyond the main building structure and are fixed to the outside face of the building. They can only be of lightweight construction; their construction needs to be assessed based upon the combustibility and fire resistance of any materials used.

Regardless of balcony type, the materials used to line the balconies (including soffits) need to be assessed in light of their likely contribution to external fire spread.

Storage of materials and other uses by residents also need to be taken into account.



Any bulk storage can pose a significant hazard, as can the use of combustion appliances such as barbecues and heaters.

Aside from the above, means of escape external walkways (a form of balcony) are not within the scope of this PAS, as any risk associated with these would need to be considered as part of the overarching FRA.

Fire Engineer Comments

These inset balconies are configured in a stacked vertical configuration on the front elevation of the building. They are formed of non-combustible materials. The steel balustrade and handrail, and the concrete soffit, will not contribute to the spread of fire across the external surface of the building. The soffit will also act to disrupt the mechanism for vertical fire spread between the balconies.


Photos

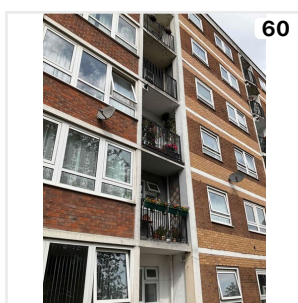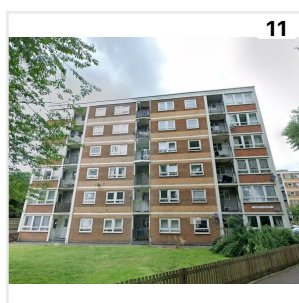

External Windows

Photo

External Window

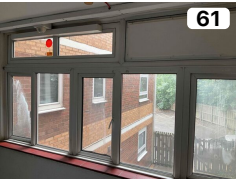

Top, Mid, Side Hung Casements (CHQ22V)

External Window: Top, Mid, Side Hung Casements

External Window Reference
CHQ22V

Details

Surface Material

uPVC


Frame Material

uPVC

Infill / Panel Material

Toughened Safety Glass

Photos

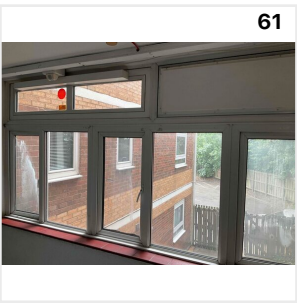

External Doors

Photo

External Door



Single Leaf Door (GESB5Q)



Single Leaf Door (RA42ZY)

External Door: Single Leaf Door

External Door Reference
GESB5Q

Details

Surface Material

Steel




Frame Material

Steel

Infill / Panel Material

Toughened Glass

Photos

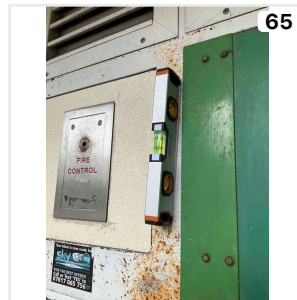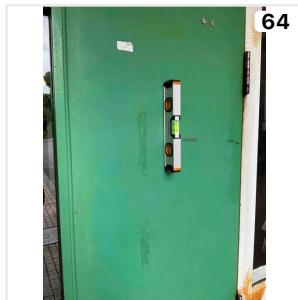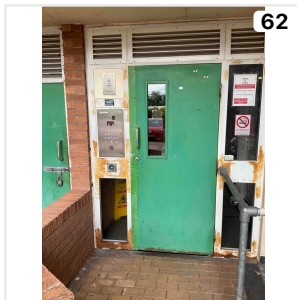

External Door: Single Leaf Door

External Door Reference
RA42ZY

Details

Surface Material

Steel



Details

Services door

Frame Material

Steel

Photos

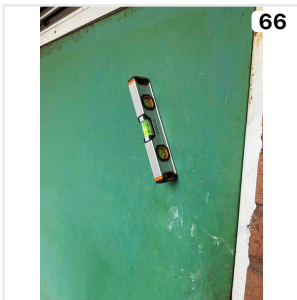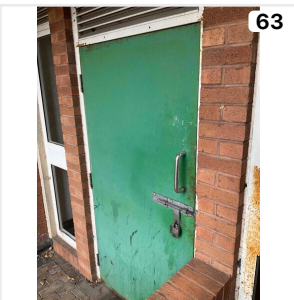


Plan: East Elevation






Plan: North Elevation




Plan: South Elevation

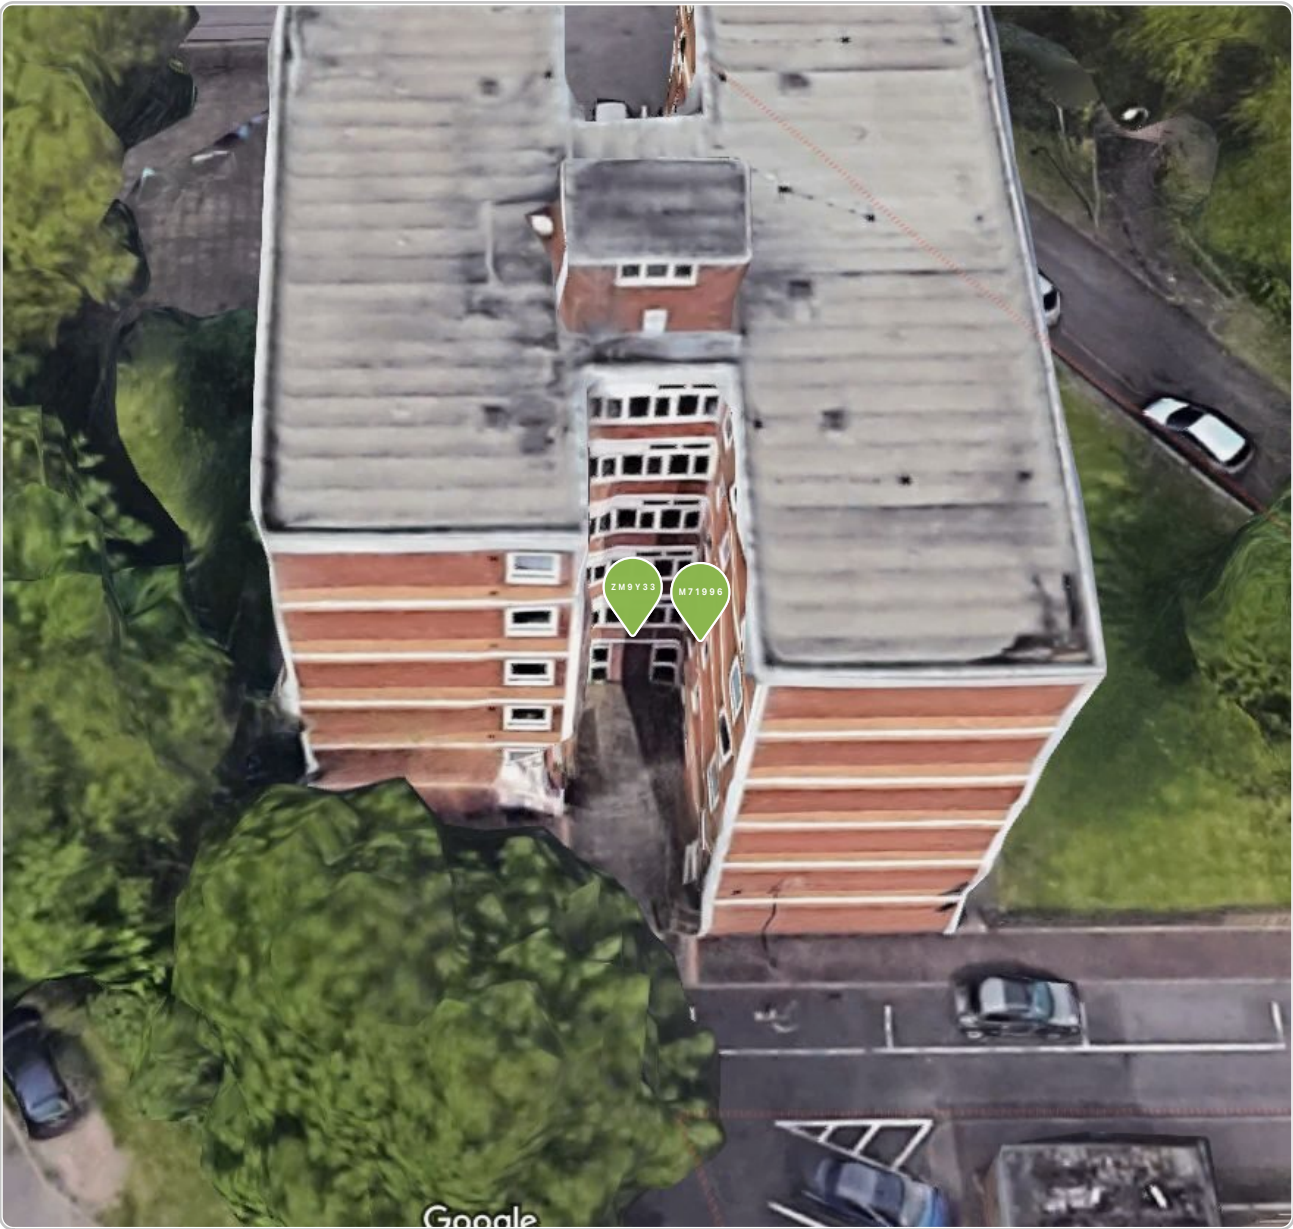

Photos

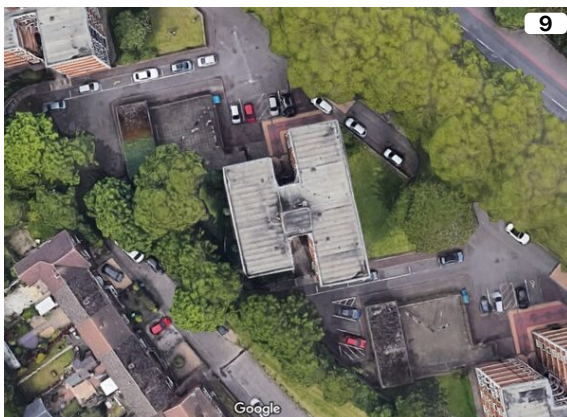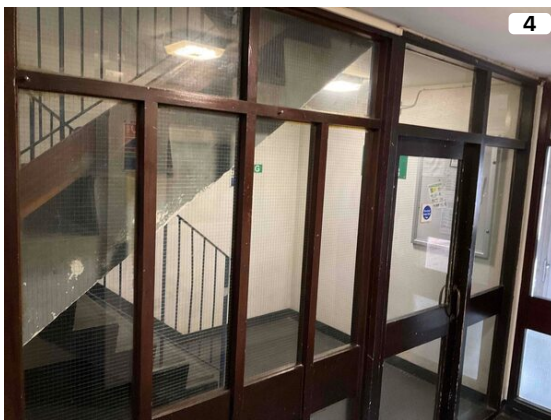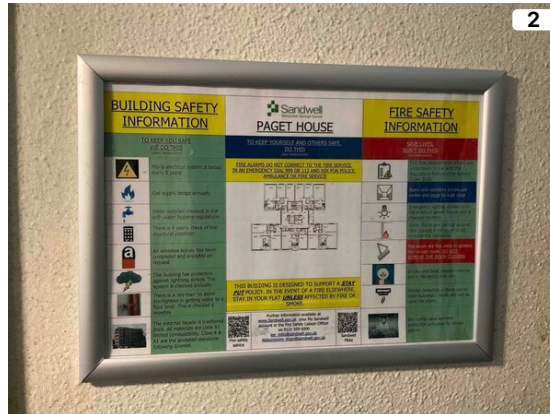


Photos Continued...

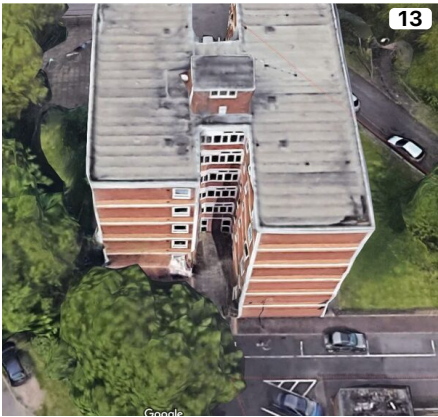

Photos Continued...



Photos Continued...

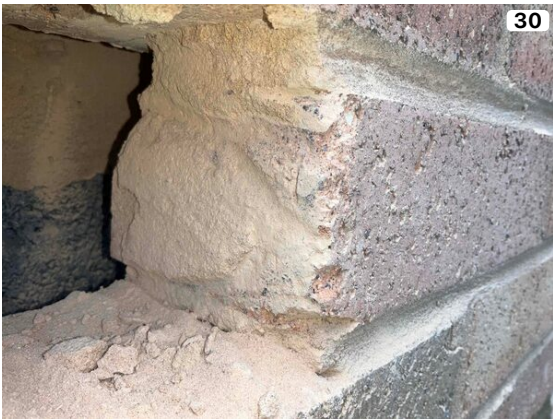

Photos Continued...



Photos Continued...



Photos Continued...



55



56



57



58



59



60



61



62



63



64



65



66



FIRNTEC
BUILDING COMPLIANCE