



FIRNTEC
BUILDING COMPLIANCE

Unit 4a, Darklake View,
Estover
Plymouth
PL6 7TL

Document Version 4

Survey Date 20/02/2025

Suggested Review Date 20/02/2030

EXTERNAL WALL SURVEY

STANTON HOUSE

Stanton House
Beaconview Road
West Brom
B71 3PW

Table of Contents

Cover Page	1
Table of Contents	2
Summary	3
Abbreviation/ Term Definition	4
Terms of Reference	5
Asset Information	7
Aerial Perspective: Stanton House Beaconview Road West Brom B71 3PW	11
Elevations	12
Inspections	13
Inspection: U4XWXB	15
Inspection: 7HDWZN	17
Inspection: VCKR7P	19
Inspection: 98LG16	21
Inspection: 77FKSI	22
Inspection: 3X4G1B	24
Attachments & Balconies	25
Attachment: Cantilever Balcony (C6ZVE2)	26
External Windows	27
External Window: Top, Mid, Side Hung Casements (1LD8W3)	28
External Doors	29
External Door: Single Leaf Entrance Doors (TNZZ9Y)	30
Plans & Elevations	31
Photos	33

Summary

External Wall Survey

Assessment and Certificate Reference

RB-JN9M6N

Assessed On, By

20/02/2025, Lee Walton

Recommended Review Date

20/02/2030

Produced For the Responsible Person

Sandwell Metropolitan Council

Specification Conforms To

Our own internal quality system.

Assessment Scope

Assessment applies only to the building specified.

Assessed Property

Property Name

Stanton House

Property Reference

RB-MBTCQG

Address

Stanton House
Beaconview Road
West Brom
B71 3PW

Assessing Organisation

Firntec Ltd

4a Darklake View, Estover, Plymouth, Devon, PL6 7TL

0345 646 1566 — www.firntec.com

Abbreviation/ Term Definition

- **ACM** Aluminium Composite Material
- **ADB** Approved Document B
- **AOV** Automatic Opening Vent
- **BSA** Building Safety Act
- **Cavity Barrier** Product used to close or separate a concealed space to restrict fire and smoke
- **Close State Cavity Barrier** Cavity Barrier designed to be fitted under compression/friction between inner and outer surfaces of a cavity to seal it
- **Open State Cavity Barrier** Cavity Barrier that is open to allow ventilation/drainage of cavity in open state but closes when a developing fire occurs (e.g., intumescent strip)
- **Combustible** Not classified as A1 OR A2 in accordance with BS EN 13501-1: 2018, and not meeting definitions of non-combustible or limited combustibility
- **Compartmentation** Subdivision of building by fire resisting walls and/or floors for limiting fire spread
- **EPS** Expanded Polystyrene
- **EWS1** External Wall System Fire Valuation Form
- **FB** Fire Barrier - Separating element with fire integrity for a specific time
- **Fire Stop** Barrier seal to close an imperfect fit in design between elements of components to stop the spread of fire
- **FRAEW** Fire Risk Appraisal of External Walls
- **FRA** Fire Risk Assessment
- **FRS** Fire and Rescue Services
- **FSA** Fire Safety Act
- **HPL** High Pressure Laminate
- **HRR** Heat Release Rate
- **MDF** Medium Density Fibre Board (a type of manufactured timber)
- **PIR** Polyisocyanurate Rigid Foam
- **PUR** Polyurethane Foam
- **RP** Responsible Person
- **RRFSO** Regulatory Reform (Fire Safety) Order
- **SFS** Steel Framing System
- **SIB** Secure Information Box # Overview

Terms of Reference

Overview

Firntec have been instructed by the client to undertake an intrusive inspection of the external walls, attachments, windows and doors to the appointed building as addressed on the cover page.

The purpose of the report is to identify the construction, make-up and materials used within each external wall type and attachment on the building as required under the Fire Safety Act 2021.

Scope of Works

The client has requested Firntec to undertake an intrusive inspection of the external walls, attachments, windows and doors.

The purpose of this survey report is to assess the external walls and attachments construction to identify the materials used, installation method, presence of any cavity barriers or fire stopping and the configuration on the building.

For any identified materials within the construction of the sample, a euro-classification rating in accordance with BS EN 13501-1 will be assigned where applicable.

Within the findings of each wall type and attachment, where applicable, detailed comments will be provided on the findings, with reference to quality of workmanship or other identified factors within the construction.

The intent of the report is not to assign any level of risk, conclusion or recommendations, but should it be identified during the intrusive investigation that there is an immediate risk to life safety, interim measures may be recommended.

Limitations

The inspection of any external wall types or attachments are undertaken by the defined terms as described in Approved Document B:

- External Wall: Includes all of the following.
 - Anything located within any space forming part of the wall.
 - Any decoration or other finish applied to any external (but not internal) surface forming part of the wall.
 - Any windows and doors in the wall.
 - Any part of a roof pitched at an angle of more than 70 degrees to the horizontal if that part of the roof adjoins a space within the building to which persons have access, but not access only for the purpose of carrying out repairs or maintenance
- Specific Attachment Includes any of the following.
 - A balcony attached to an external wall.
 - A device for reducing heat gain within a building by deflecting sunlight which is attached to an external wall.
 - A solar panel attached to an external wall.

The findings within the report will not state any areas of compliance with advisory sub-clauses of the relevant Approved Document B, nor does it aim to guarantee compliance with the mandatory clause of B4(1) and our comments cannot be interpreted as such.

We endeavour to undertake intrusive inspections at various elevations and varying heights, however, this may not always be achievable due to mitigating factors out of our control such as access or weather conditions.

The findings of the investigation are limited to each precise inspection location and cannot be used to confirm absolute consistency of the façade in its entirety.

The manufacturer of a product cannot be confirmed with absolute certainty unless the sampled materials carry the product branding inclusive of the product number.

Where product branding is absent or ambiguous, we will where provided, refer to as-built drawings and

specification contained in the O&M manuals, However, this does not guarantee or confirm the products used in construction.

Assumptions

It is understood that the absence of evidence, is not evidence of the absence; therefore, Where a products branding is absent we will use our professional engineering judgment, and any assumptions made with regards to the materials combustibility should be submitted for further testing to verify this.

It has been assumed that documentation regarding the buildings fire safety, fire strategy, construction details and O&M manuals have been provided for our reference within the report.

Outcomes

The findings within this report do not assign any level of risk, conclusion or recommendations, nor does it confirm any compliance with applicable building regulations at the time of construction.

The findings of this report may form part of the gathered information to form such reports as:

- PAS9980:2022 Fire risk appraisal of external wall construction and cladding of existing blocks of flats – Code of practice or;
- External Wall Compliance at Time of Construction Report.

If during the intrusive survey any ACM is identified to be present, this will be reflected within the report and evidence requested to determine its calorific value, if this evidence is not available a request of sample testing may be recommended separate to this report.

Asset Information

Client Name

Sandwell Metropolitan Council

Responsible Person

Sandwell Metropolitan Council

Contact Details

0121 569 0162 - Lisa Ellis

Fire Alarm System

There is no BS5839 (Part 6 or Part 1) Fire detection/alarm system provided in the common areas of the building. The smoke detection provided is part of the smoke ventilation system, with the control panel on the ground floor nearest the main entrance.

Emergency Lighting

Installed in communal parts

Emergency Lighting

Emergency lighting appears to conform to the requirements of BS5266-1 design standard. The system appears to provide adequate coverage and be in good working order (indicator lights active on luminaires). Luminaires appear to be correctly sited and appear to provide adequate lighting.

Portable Fire Fighting Equipment

Portable Fire Fighting Equipment installed within staff only / Restricted areas of the building

Smoke Control

Natural smoke control, Smoke control installed

Smoke Control

The stairs and/or lobbies are provided with adequate permanent or manually operated ventilation openings for the control of smoke. Manual openable windows within the stairwell and the stairs and lobbies are provided with an automatic smoke ventilation system

Suppression Systems

Partial sprinkler system installed (Detailed in Description)

Suppression System

A suppression system is installed within high risk areas such as the refuse/bin store

Fire Fighting Facilities

Dry Riser

Fire Fighting Facilities

Dry riser outlets were located on each floor within the firefighting lobby area, ensuring accessible water supply for firefighting operations. This placement allows for efficient connection of firefighting hoses, providing vital water access to emergency services during fire incidents across all floor levels.

Access for fire-fighting vehicles

Adequate access for firefighting vehicles
NOTE This is where access is possible in line with benchmark guidance on access for firefighting vehicles from Approved Document B, taking into account the size of the building (floor area), height of the building and whether fire mains are present in the building.

Fire Hydrant Location/ Water Supply

Public fire hydrant is available, located in close proximity to the front of the building, as detailed in the On Arrival Information. The fire hydrant can be located to the left hand side of the main access point of the block and can be found on the orientation plan located in the premise information box.
Public fire hydrants can be located: <https://dataservices.riscauthority.co.uk/map/index>

Housekeeping

Good standard. Means of escape clear. Refuse stored appropriately

Secure Information Boxes

Secure information box (SIB) installed

Signage

Appropriate signage installed throughout premises

Property Type

Residential

Building Era / Age

Known Build Date

Known Build Date

1964

Building Height

Approximately 24m to the highest occupied floor level. (calculated at 3m per floor as per PAS 9980-2022 section 3.1.22)

Number of Storeys (Ground and above)

9

Number of Flats

36

Flat Types

Single Storey

Structural Wall Material

Concrete / Brick

Structural Floor Material

Reinforced Concrete

Structural Stairs Material

Concrete

Construction (Details)

Traditional concrete frame and brick construction

Exterior Cladding

FRAEW Completed on Exterior Cladding

Exterior Cladding (Details)

TRESPA High pressure laminate panel , Rockwool insulated render (A2) - Brick, Brick slips on 100mm rockwool.

Electronic Entrance System

Yes

Carpark

External/Outdoor Carpark

Employees

Day staff

Employees (Extended)

No staff on site (Occasional staff attendance expected - low numbers anticipated)

Residents

Yes

Approx number of Residents

72

Residents (Extended)

Assumed to be two residents per flat (Exact numbers not known)

Visitors

Day

Visitors (Extended)

Residential block - low number of visitors expected at any one time

People With Reduced Mobility

None

People with Reduced Mobility (Extended)

General Needs - No information however, General Needs premises so occupants are typical of the general population

Lone Workers

None

Young Persons Employed in the Premises

None

Escapes & Exits

There are sufficient fire exits from the premises of suitable width and within acceptable travel distances. These will allow all persons in the premises to evacuate safely in the event of fire. Emergency exits open outwards in escape direction.

Number Of Internal Escape Stairs

1

Number Of Final Exits

2

External Means Of Escape

None Present

Types Of Lifts Installed

Passenger + Fireman's Control

Evacuation Chairs Installed

No

Stairwells Protected / Lobbied

Yes

Flat Doors Open Onto Stairs

No

Current Evacuation Strategy


Stay Put

What is the recommended evacuation strategy for the property?

Stay Put

Aerial Perspective: Stanton House Beaconview Road West Brom B71 3PW

Aerial Perspective (picture sourced from Google Earth)

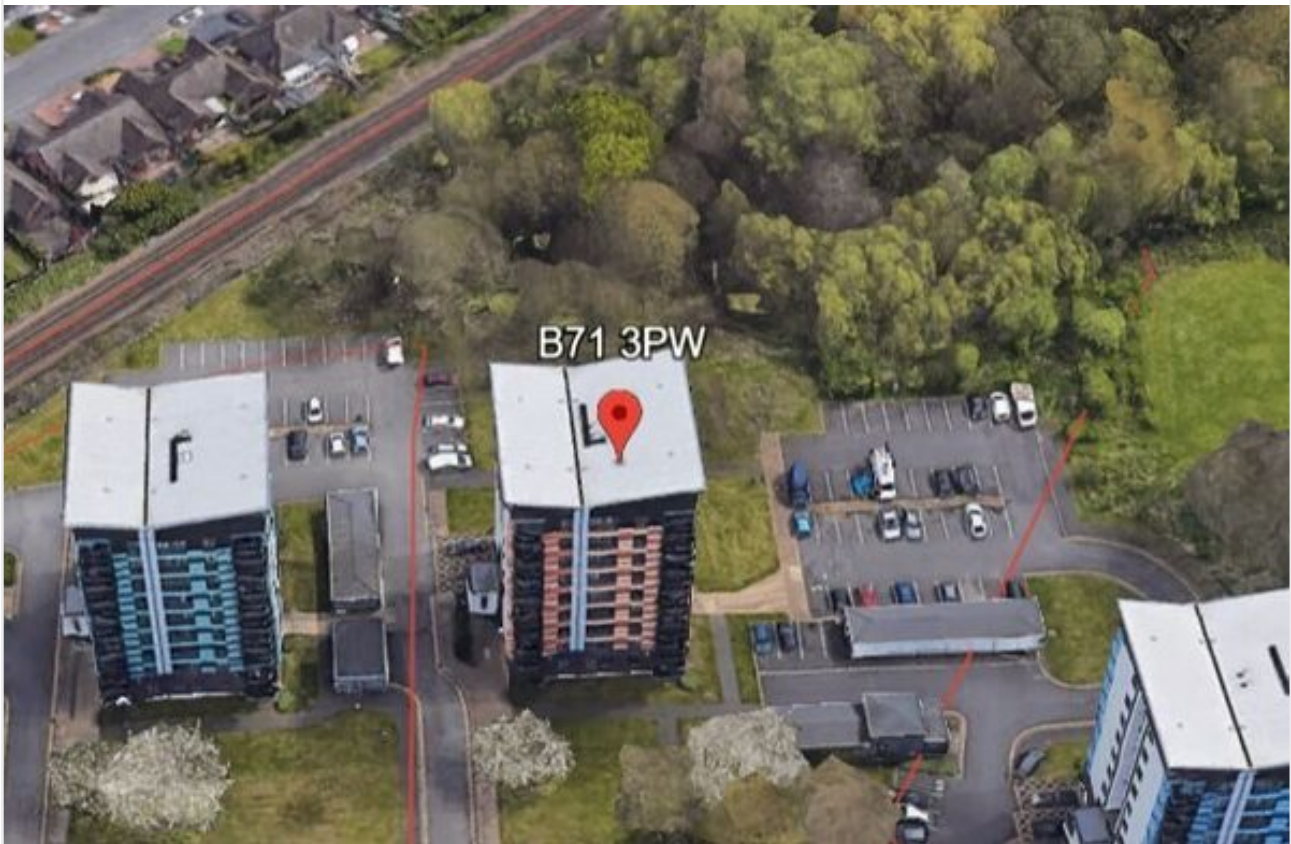

Elevations


Photo	Name	No. of Storeys	Features
	NORTH	9 Storeys	
	SOUTH	9 Storeys	
	EAST	9 Storeys	• Private Balconies Stacked
	WEST	9 Storeys	• Private Balconies Stacked

Inspections

Elevation Location


Inspection

Elements

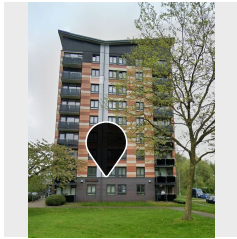


Inspection: U4XWXB
WEST
FLOOR SLAB JUNCTION

- Surface Finish (Brickwork)
- Cavity
- Insulation (Mineral Wool Insulation)
- Inner Leaf Support (Backing Wall) (Original blockwork)

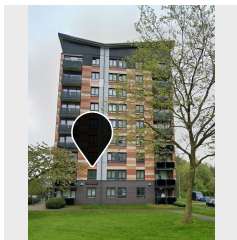


Inspection: 7HDWZN
WEST
JUNCTION WITH OTHER FACADE TYPES

- Surface Finish (Suspected High Pressure Laminate (HPL) Panel)
- Cavity
- Insulation (Mineral Wool Insulation)
- Inner Leaf Support (Backing Wall) (Concrete wall)

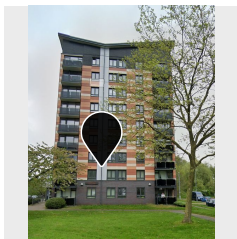


Inspection: VCKR7P
WEST
PANEL BUILD UP -PLUS JUNCTION WITH OTHER FACADE TYPES

- Surface Finish (Suspected High Pressure Laminate (HPL) Panel)
- Cavity
- Insulation (Mineral Wool Insulation)
- Inner Leaf Support (Backing Wall) (Reinforced concrete)

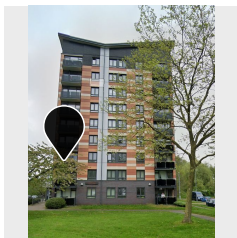


Inspection: 98LG16
WEST
BALCONY

No elements identified

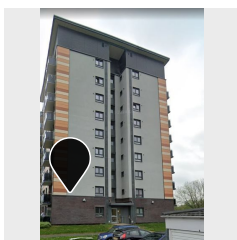

Inspection: 77FKSI
SOUTH
JUNCTION TO BRICKWORK FLOOR SLAB AND TERRACOTTA TILED SECTIONS

- Surface Finish (Sto render)
- Insulation (Mineral Wool Insulation)
- Inner Leaf Support (Backing Wall) (Concrete wall)

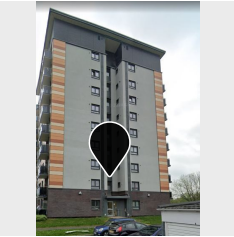

Inspection: 3X4G1B
SOUTH
CURTAIN STAIRWELL WALL

- Spandrel Panel (Aluminium Panel)

Inspection: U4XWXB

Elevation • Location
WEST • FLOOR SLAB JUNCTION



Name/Summary

BRICKWORK - WEST ELEVATION

Build-Up

4 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
Surface Finish	100mm	Brickwork	5, 6	A1 - Non-Combustible
Cavity	30mm		7, 8, 9	
Insulation	90mm	Mineral Wool Insulation	10, 11	A1 - Non-Combustible
Inner Leaf Support (Backing Wall)		Original blockwork	12, 13	A1 - Non-Combustible



Cavity Barriers

1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Solid State Mineral Wool	

Floor Slab

Backing Wall Sits On The Floor Slab

Build-up Photos

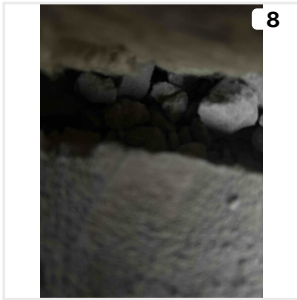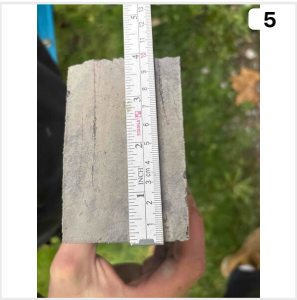

Inspection: 7HDWZN

Elevation • Location
WEST • JUNCTION WITH OTHER FACADE TYPES



Name/Summary

PANEL- WEST ELEVATION

Build-Up

4 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
Surface Finish	10mm	Suspected High Pressure Laminate (HPL) Panel Material Brand: TRESPA	14, 15	D - Highly Combustible
Cladding				
Cavity	90mm		16, 17, 18, 19	
Insulation	90mm	Mineral Wool Insulation	20, 21	A1 - Non-Combustible
Inner Leaf Support (Backing Wall)		Concrete wall	22	A1 - Non-Combustible


Cavity Barriers

1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Solid State Mineral Wool	

Floor Slab

Reinforced concrete

Build-up Photos

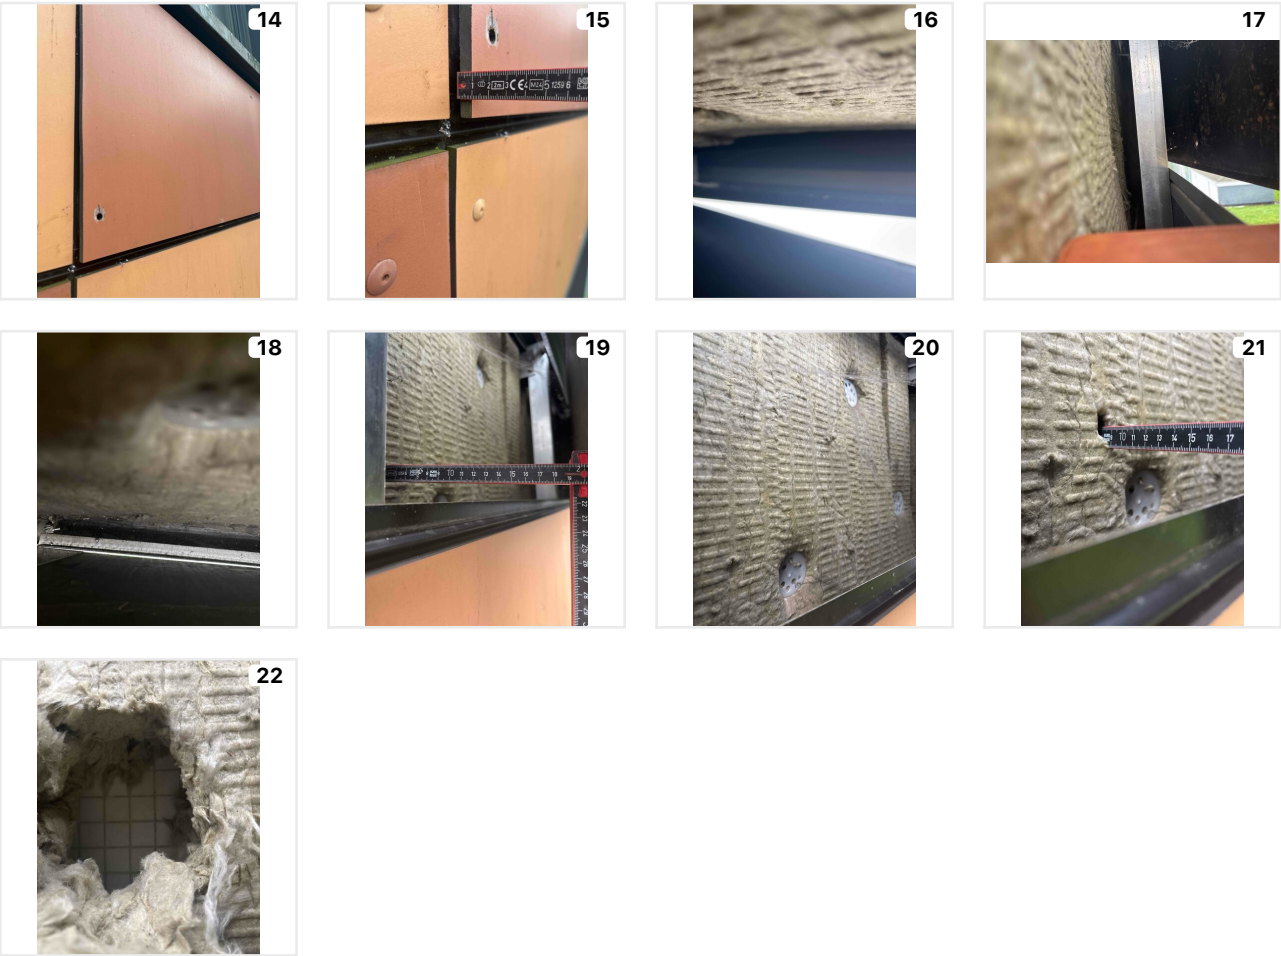

Inspection: VCKR7P

Elevation • Location
WEST • PANEL BUILD UP -PLUS JUNCTION WITH OTHER FACADE TYPES



Name/Summary

PANEL SYSTEM - WEST ELEVATION

Build-Up

4 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
Surface Finish	10mm	Suspected High Pressure Laminate (HPL) Panel Material Brand: TRESPA	23, 24	D - Highly Combustible
Cladding				
Cavity	90mm		25, 26, 27	
Insulation	50mm	Mineral Wool Insulation	28	A1 - Non-Combustible
Inner Leaf Support (Backing Wall)		Reinforced concrete Material Brand: Concrete wall	29	A1 - Non-Combustible


Cavity Barriers

1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Solid State Mineral Wool	

Floor Slab

Reinforced concrete

Build-up Photos

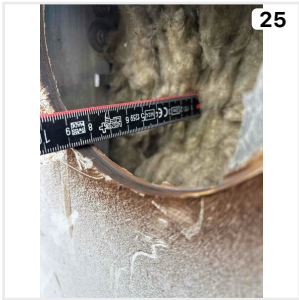

Inspection: 98LG16

Elevation • Location
WEST • BALCONY




Name/Summary

BALCONIES - WEST ELEVATION


Inspection Photos



30

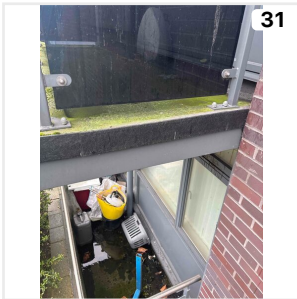


31

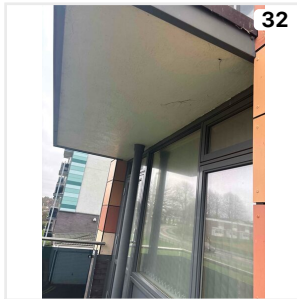


32



33

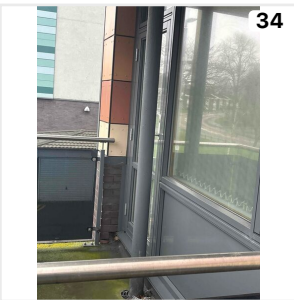

34

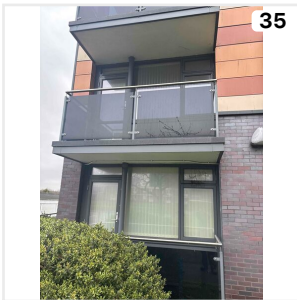

35

Inspection: 77FKSI

Elevation • Location

SOUTH • JUNCTION TO BRICKWORK FLOOR SLAB AND TERRACOTTA
TILED SECTIONS



Name/Summary

RENDER SYSTEM - SOUTH ELEVATION

Build-Up

3 Elements	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
Surface Finish	9mm	Sto render	36, 37	A1 - Non-Combustible
Insulation		Mineral Wool Insulation	38, 39	A1 - Non-Combustible
Inner Leaf Support (Backing Wall)		Concrete wall	40, 41	A1 - Non-Combustible

Cavity Barriers

1 Cavity Barrier	Material	Photo Ref.
Horizontal Cavity Barrier	Solid State Mineral Wool	

Floor Slab

Reinforced concrete

Build-up Photos



Inspection: 3X4G1B

Elevation • Location
SOUTH • CURTAIN STAIRWELL WALL




Name/Summary

SPANDRELS - SOUTH ELEVATION



Build-Up

1 Element	Thickness/Depth	Material	Photo Ref.	Rating (BS EN13501)
Spandrel Panel	30mm	Aluminium Panel	42	A1 - Non-Combustible

Build-up Photos

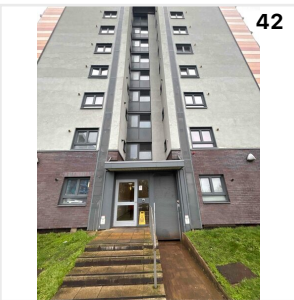

Inspection Photos

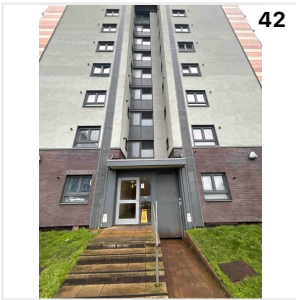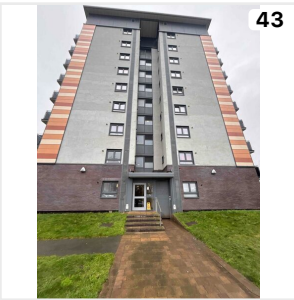

Attachments & Balconies

Photo

Attachment



Cantilever Balcony (C6ZVE2)

Configuration: Stacked, Single Unit

Size: Private balcony spanning only a single compartment

Attachment: Cantilever Balcony

Attachment Reference
C6ZVE2

Details

Configuration

Stacked, Single Unit

Size

Private balcony spanning only a single compartment

Framework/Structure

Reinforced concrete framework extension of the floor slab




Balustrade

Steel handrail and balusters with clear glazing

Soffit

Concrete

Photos

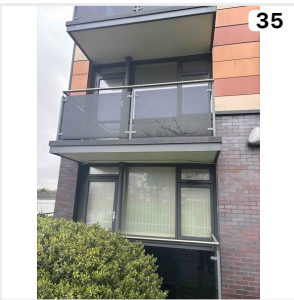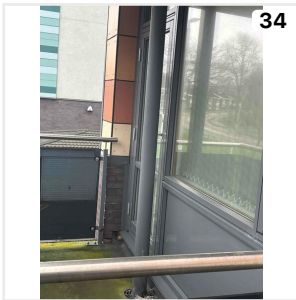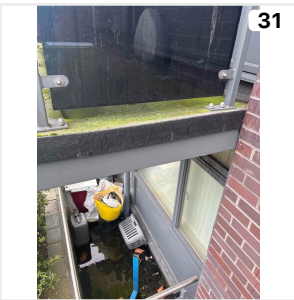

External Windows

Photo

External Window



Top, Mid, Side Hung Casements (1LD8W3)

External Window: Top, Mid, Side Hung Casements

External Window Reference
1LD8W3

Details

Surface Material

Aluminium

Frame Material

Aluminium

Infill / Panel Material

Toughened Glass

Photos



External Doors

Photo

External Door



Single Leaf Entrance Doors (TNZZ9Y)

External Door: Single Leaf Entrance Doors

External Door Reference
TNZZ9Y

Details

Surface Material

uPVC

Frame Material

uPVC

Infill / Panel Material

Toughened Glass

Photos



Plan: WEST



Plan: SOUTH




Photos



Photos Continued...



Photos Continued...

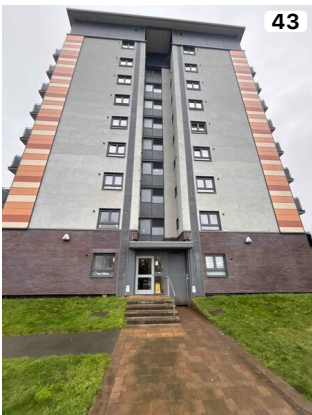



FIRNTEC
BUILDING COMPLIANCE